

|                                 |                                                                                    |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |                     |
|---------------------------------|------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------|
| All 3.0L TDV6 equipped vehicles | A customer may experience a CEL & Restricted Performance on the Instrument cluster | P0299-77 for <i>“Turbocharger Underboost Conditions”</i> , may be stored in the PCM. Exhaust primary & secondary diagnosis for this DTC. Leak test the intake- a leak could interrupt the function of vacuum actuation. Check for signs of excessive sooting or oil deposits in the intake. Check the throttle body for signs of excessive carbon. If carbon is found on the throttle body, take clear pictures of the carbon found & the part label. Raise a TA if you require additional support, otherwise create an EPQR and hold onto the throttle body/map sensor if you replace parts. | Under Investigation |
|---------------------------------|------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------|