

Reference	SSM73966
Models	E-PACE / X540 F-PACE / X761 XE / X760 XF / X260
Title	AJ20P MIL Illuminated - P144C-00 stored in the PCM
Category	Driveability
Last modified	18-Jul-2018 00:00:00
Symptom	698298 Malfunction Indicator Lamp
Content	<p><u>Issue:</u> The customer reports a MIL and P144C-00 is observed in the PCM.</p> <p><u>Cause:</u> Currently under investigation. Early indications show it is not always due to a leak in the purge line connection, but an issue or repair action that may have caused a fueling adaption drift.</p> <p><u>Action:</u> Investigate and resolve all fuel system DTCs which are, or have historically, flagged in the PCM. Do not replace the purge valve if P144C-00 is set in isolation. Once repairs have been completed, reset the PCM fueling adaption values. Drive the vehicle (a short drive consisting of a highway cruise for approximately 5 minutes and a short city style stop/start drive is sufficient) in order to confirm the vehicle is now repaired prior to returning to the customer.</p> <p>Technicians - Please rate this SSM and provide comments so that future communications can be improved.</p> <p>1 = Poor – Basic information provided – The SSM does not help me resolve the customer concern.</p>

3 = Average – Adequate information provided – The SSM partially helps me resolve the customer concern.

5 = Excellent – All required information provided to resolve the customer concern.