

SS 1033315 - WST 5700 Exhaust Pipe Installation Bracket Improvements

WST 5700 Exhaust Pipe Installation Bracket Improvements

Applicable Vehicles

WST 5700

Symptoms

Early and repetitive failures of the Exhaust Pipe Installation Brackets.

Issue

More robust design of Exhaust Pipe Bracket is available for current application.


Solution

A new Exhaust Pipe Bracket is available and can replace the current production bracket with minor additions as described below:


Retrofit of 5700 Exhaust Brackets:

Current installation shows items 7, 04-31835-00 (2Plcs) that need to be updated with new bracket 04-32929-000:

001 – INSTL. EXHAUST, 016-1C3, 2 BRKT, DD15/3

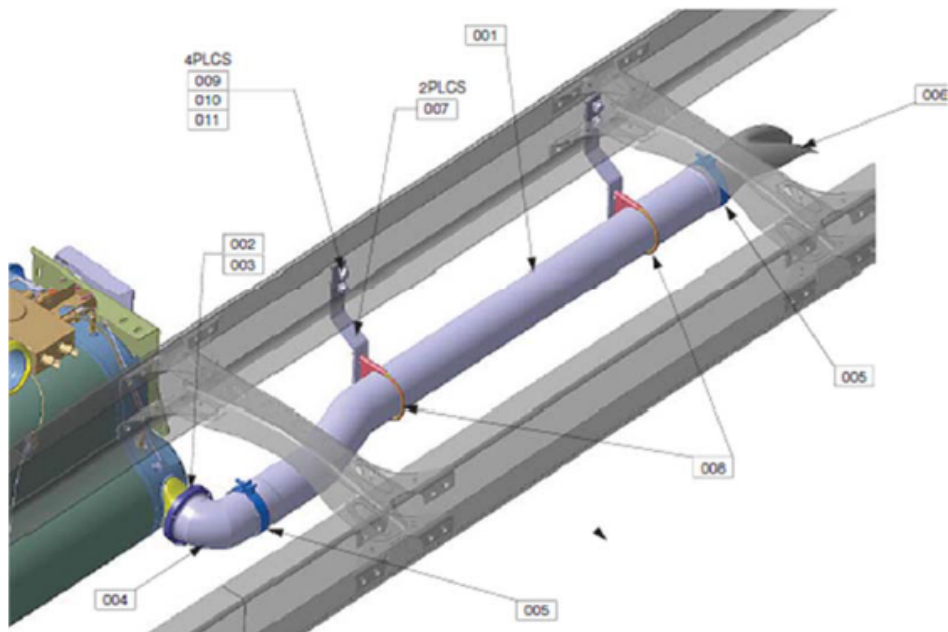

Remove 04-31835-000 and mounting bolts/nuts and install 04-32929-000 adding spacer: 23-10889-025 (2 pieces per bracket install) or 23-09114-002 (3 pieces per bracket – 6 pieces total) in the clamp side as shown.

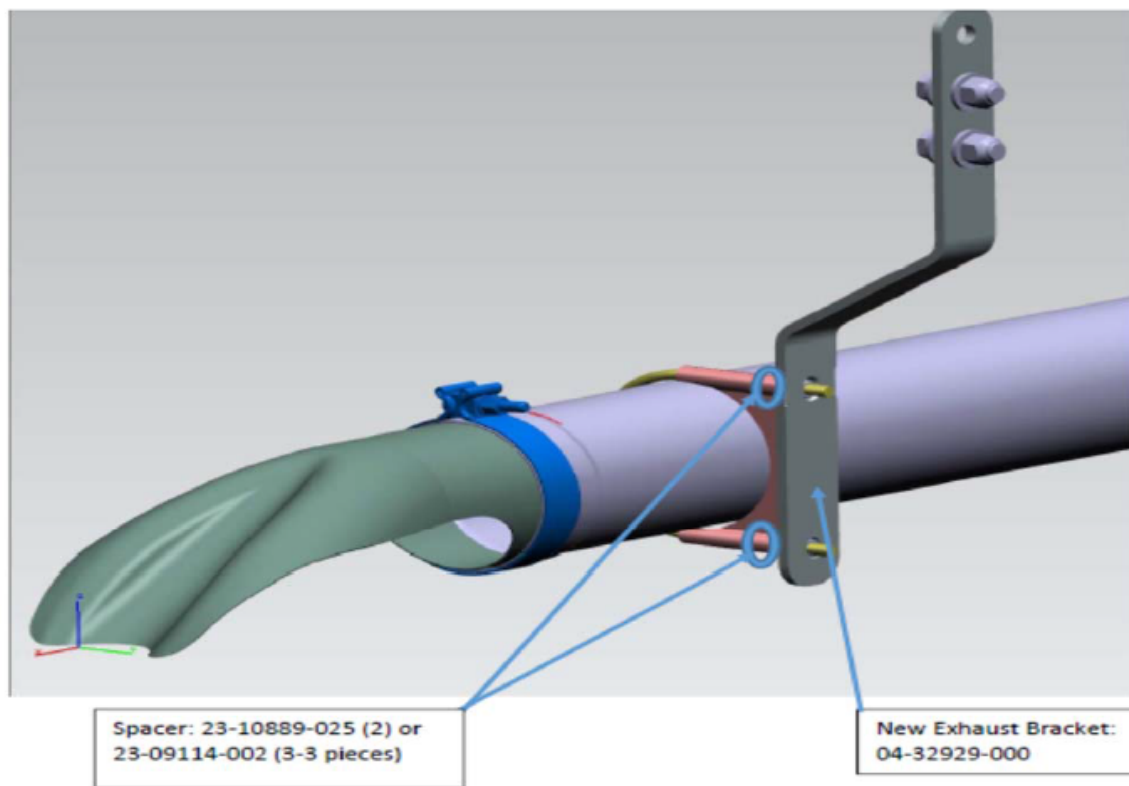

SS 1033315 - WST 5700 Exhaust Pipe Installation Bracket Improvements

Contact the WST DSM or the WST Field Service Team if you have comments or questions.