

NEW DIAGNOSTIC SOFTWARE AVAILABLE FOR DOWNLOAD



Notice Information

Ref	8227
Posted Date:	
Posted To:	General Manager / Business Owner, Technician, Aftersales Manager, Service Leader / Advisor
Subject:	Service/Technical

TOL NOTICE (US&CAN) – September 20, 2018

TOL Ref. # 8227-SVC

New Diagnostic Software Available for Download

Diagnostic software version 2018-8 is now available to download. Dealers should download this update from your Triumph Diagnostic Software page under the Service/Technical menu and begin using immediately.

- Please ensure all new bikes have the latest software downloaded at PDI.
- Please ensure all bikes being serviced have the latest software downloaded.
- Please ensure all relevant staff are informed of this update

PASSWORD: No change to password: (case sensitive) Cafe1902

SUMMARY OF CHANGES:

- | | | |
|---|---|---|
| 1 | New Software Functionality: | None |
| 2 | New Calibrations: | None |
| 3 | Replacement Engine ECM Calibrations: | None |
| 4 | Replacement Chassis ECM Calibrations: | <p>Tiger 1200 XR Chassis calibrations updated (CHA00009 all markets).</p> <p>New Calibration ID1 file 000904.</p> <p>Allows chassis ECM to be recovered and unlocked in the event of an incorrect calibration download.</p> |
| 5 | Replacement Instrument ECM Calibrations: | <p>Update to application software (V2.04) – All models with TFT instruments</p> <p>Update to configuration files – Speed Triple and Tiger 1200 models with TFT instruments</p> |
| 6 | Replacement Keyless ECM Calibrations: | <p>Speed Triple RS calibrations updated (IMM00020_ROW, IMM00021_JP and IMM00022_US).</p> <p>(New Calibration ID2 file 008703).</p> <p>Resolves ECM unlocking issues seen on certain VINs.</p> |

7 **New ECU Unlock Codes:** -

8 **Calibration Description Corrections:** -

Immobilizer Diagnostics Connection Issues:

Affected Version: 2018-07

Affected Models: Tiger Explorer models with chassis ECM

9 **Bug Fix(es):**

Description: Unable to connect to immobiliser diagnostics when no keys are paired (i.e. replacement units)

Fix: Function restored in version 2018-08.

If you have any questions, please contact Triumph Customer Support at (888) 284-6288.