



Preliminary Information

PIP5595 Shifter click noise, shifter boot appears tight or bulge in the shifter boot

Models


Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Colorado	2018 - 2019	All	All	All	N8D
GMC	Canyon	2018 - 2019	All	All	All	N8D

Involved Region or Country	North America
Condition	Click noise from the shifter area or customer complaints of the shifter boot is tight or has a bulge in it.
Cause	Transmission isolator boot is not fully seated

Correction

Some customers have commented on a click noise when shifting or that the leather boot covering the shifter assembly is pulled tight in some gears and or may be bulging out near the bottom of the knob. If the isolator (1) below is not in the correct orientation or fully pushed down and seated in the correct position any one of the before mentioned complaints could be noted.

Remove the shifter boot and push the isolator down into the correct position and reinstall the boot. There is no reason to replace the boot.

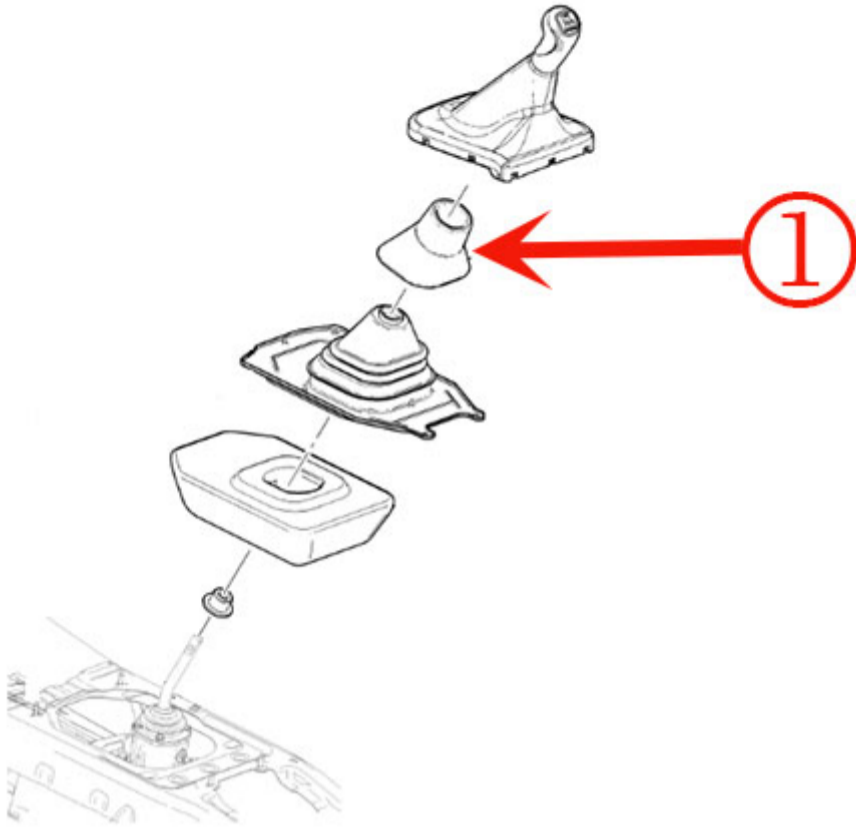

Warranty Information

Labor Operation	Description	Labor Time
8440200	Transmission Control Lever Boot Replacement	Use Published Labor Time

Version History

Version	1
Modified	10/02/2018 - Created on



GENERAL MOTORS

© 2018 General Motors. All Rights Reserved.