



Preliminary Information

PIT5635 Squeak / Rattle Noise from Rear of Vehicle Over Bumps Thought to be From the Leaf Springs.

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Colorado	2015 - 2019	All	All	All	All
GMC	Canyon	2015 - 2019	All	All	All	All

Involved Region or Country:	North America
Additional RPO/s:	None
Condition:	Squeak or rattle noise from the rear of the vehicle over bumps / washboard thought to be from the leaf springs .
Cause:	This noise can be caused by the rear brake pads shifting .

Correction:

Before servicing the leaf springs move the chassis ears to the rear brake backing plates. If the noise is isolated there, remove the rear brake pads and apply grease or anti- squeak compound to the rear of the pads and re-evaluate. Engineering is investigating this concern if there is new information this PI will be updated.

Warranty Information

Labor Operation:	Description:	Labor Time:
2420170	Remove And Reinstall Brake Pads	0.8 Hrs.

Version History

Version	1
Modified	10/10/2018 - Created on

