

L62X-A.05.18	To: Subject: Date: Pages	Official After Sales Network Bracket protection upgrade 18 June 2018 9	
--------------	---	---	--

Campaign code:

L62X-A.05.18

Campaign description:

Bracket protection upgrade

Model:

Huracan Coupè and Spyder

Model year:

From 2018

Special or Limited Versions:

None

Markets:

All

VIN identification

From Vin JLA08797 to vin JLA09077; Which are included in the list below

From 8797 to 8834	From 8835 to 8870	From 8871 To 8909	From 8910 to 8950	From 8951 to 9000	From 9001 to 9077
JLA8797	JLA8835	JLA8871	JLA8910	JLA8951	JLA9001
JLA8800	JLA8836	JLA8873	JLA8911	JLA8952	JLA9002
JLA8801	JLA8837	JLA8874	JLA8912	JLA8953	JLA9003
JLA8802	JLA8838	JLA8875	JLA8913	JLA8955	JLA9004
JLA8803	JLA8839	JLA8876	JLA8914	JLA8956	JLA9005
JLA8804	JLA8840	JLA8877	JLA8916	JLA8957	JLA9007
JLA8805	JLA8842	JLA8878	JLA8918	JLA8960	JLA9008
JLA8806	JLA8844	JLA8879	JLA8920	JLA8961	JLA9009
JLA8807	JLA8845	JLA8880	JLA8921	JLA8962	JLA9011
JLA8808	JLA8846	JLA8881	JLA8922	JLA8965	JLA9016
JLA8809	JLA8847	JLA8882	JLA8923	JLA8967	JLA9017
JLA8810	JLA8848	JLA8883	JLA8924	JLA8968	JLA9018
JLA8811	JLA8849	JLA8885	JLA8925	JLA8970	JLA9020
JLA8812	JLA8851	JLA8886	JLA8926	JLA8971	JLA9023
JLA8815	JLA8852	JLA8888	JLA8927	JLA8976	JLA9024
JLA8816	JLA8853	JLA8890	JLA8928	JLA8977	JLA9030
JLA8817	JLA8854	JLA8891	JLA8930	JLA8978	JLA9035
JLA8818	JLA8855	JLA8892	JLA8931	JLA8979	JLA9042
JLA8820	JLA8856	JLA8893	JLA8933	JLA8980	JLA9043
JLA8821	JLA8857	JLA8894	JLA8934	JLA8981	JLA9045
JLA8822	JLA8858	JLA8896	JLA8935	JLA8983	JLA9046
JLA8823	JLA8859	JLA8897	JLA8937	JLA8987	JLA9047
JLA8824	JLA8860	JLA8898	JLA8938	JLA8988	JLA9049

From 8797 to 8834	From 8835 to 8870	From 8871 To 8909	From 8910 to 8950	From 8951 to 9000	From 9001 to 9077
JLA8826	JLA8861	JLA8899	JLA8939	JLA8989	JLA9055
JLA8827	JLA8862	JLA8901	JLA8942	JLA8990	JLA9058
JLA8829	JLA8863	JLA8902	JLA8943	JLA8995	JLA9060
JLA8830	JLA8864	JLA8903	JLA8944	JLA8996	JLA9062
JLA8831	JLA8865	JLA8906	JLA8946	JLA8997	JLA9068
JLA8832	JLA8866	JLA8907	JLA8947	JLA8998	JLA9069
JLA8833	JLA8868	JLA8908	JLA8949	JLA8999	JLA9076
JLA8834	JLA8870	JLA8909	JLA8950	JLA9000	JLA9077

Warning: before starting with the repair, log to the Warranty portal and check through VIN Info:

- The vehicle is effectively involved by these bulletin instructions; some cars may not be included even when they are in the VIN range.
- The procedure identified by a letter (e.g. A, B or C....etc. whose differences are explained below in this bulletin), taking care to order and use the parts corresponding to the assigned procedure.

Example

VIN	17 DIGIT VIN	Model	MODEL NAME	Warranty Start Date	DD/MM/YYYY	Warranty End Date	DD/MM/YYYY	
Total days of workshop repairs: 0								
Prior activated CPO list								
CPO	Validity months	Classification	Mileage	Insertion date	Approval date	Start date	Expire date	Claim status



Note

Procedure A will be available only when the instructions require to carry out a preliminary control to determine whether or not a vehicle needs to be updated.

Information to the field

As a result of the continuous monitoring of the product, Automobili Lamborghini Spa found that some vehicles could have been produced without the protection of the ABS and ESP control unit mounting bracket.

Field solution

The instruction herein detailed describes the operation: B, which concerns the installation of a new protection.

Spare parts.

Order the following part number which are connected to the operation required:

Rev.01	The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A.	1/9 doc. nr: L/V6_M06 Rev.[04]
--------	--	--

L62X-
A.05.18

To: Official After Sales Network
Subject: Bracket protection upgrade
Date: 18 June 2018
Pages: 9



- Operation B – Protection installation.

P/N	Description	Q
701947149A	Bracket protection.	2

Replaced parts management.

Store properly and tagged the parts replaced with bar code form for their identification during Area Manager visits.

Labour time

- Protection installation: 0,5 h.


Substituted former Bulletins.

None.

Warranty Claim instructions

To claim the reimbursement log into the warranty system management on the Lamborghini Portal and consults the manual “W.Claim “ available on the portal for the download .

Select the desired campaign and go on with the claim insertion, read carefully the windows message content and choose the option button corresponding to the operation performed .

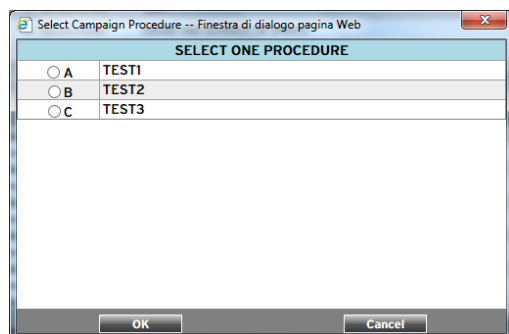

On the base of the chosen option the reimbursement will be:

- OPTION B, Protection installation
manpower: 0,5.
spare parts: 701947149A.



ATTENTION!


Attach all documents produced during the vehicle visit that show evidence of the work performed such as repair order, software protocols or acquisitions...etc.; the lack of one or more of those, may deny the reimbursement.

Remember to fill all data in the section “Service and Recall Campaign” in the Warranty booklet of the vehicle as shown below.

A. Removing/Installing the tool kits, left and right side :



1. Remove the tool kits.

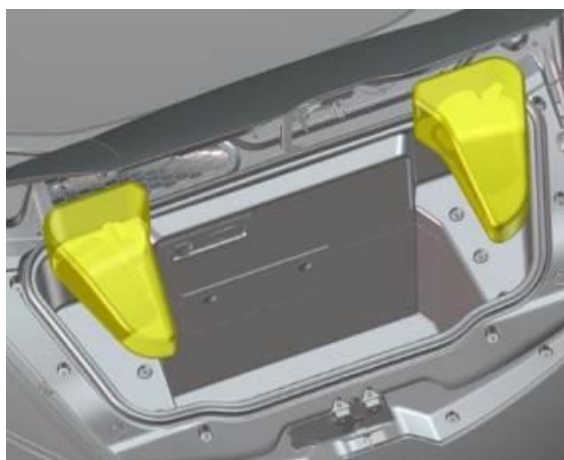

B. Removing/Installing the complete ornament for the clip on the luggage

2. Remove the 4 mounting screws.



Notes for re-installation.

Tighten the screws.

Tightening torque: **1.00 Nm (0.74 lbf ft) ± 20%.**



3. Pull out the ornament.



4. Disconnect the connector from the clip on the luggage compartment light and the 12 V socket.




C. Removing/Installing the seat containing the ornament for the clip on the luggage compartment light and the 12 V socket

5. Thread the cable through the hole.



6. Remove the ornament seat.

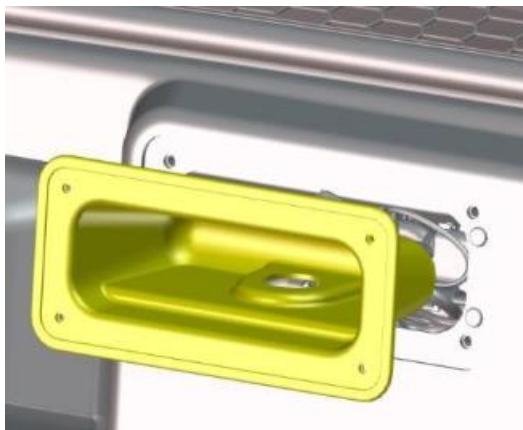

D. Removing/Installing the battery access cover

7. Rotate the 2 stops and remove the cover.



8. Disconnect the earth cable on the cover.



Notes for re-installation.

Tighten the screw.

Tightening torque: **2,00 Nm (1,48 lbf ft) ± 20%.**



E. Removing/Installing the luggage compartment gasket

9. Remove the gasket.



F. Removing/Installing the luggage compartment


10. Remove the 6 screws and their washers.



Notes for re-installation.

Tighten the screw.

Tightening torque: **5,00 Nm (3,69 lbf ft) ± 20%.**

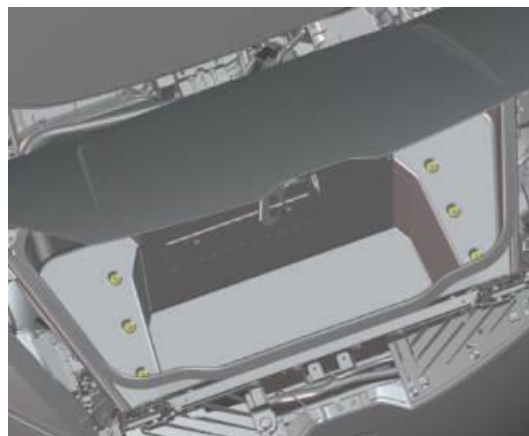




11. Remove the 3 screws and their washers.




Notes for re-installation.

Tighten the screw.

Tightening torque: **5,00 Nm (3,69 lbf ft) ± 20%.**

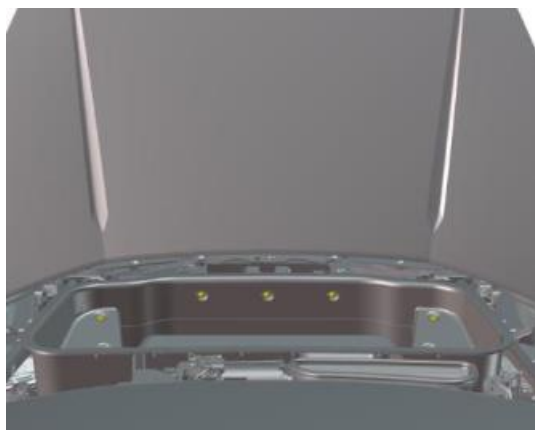

12. Pull out the luggage compartment.

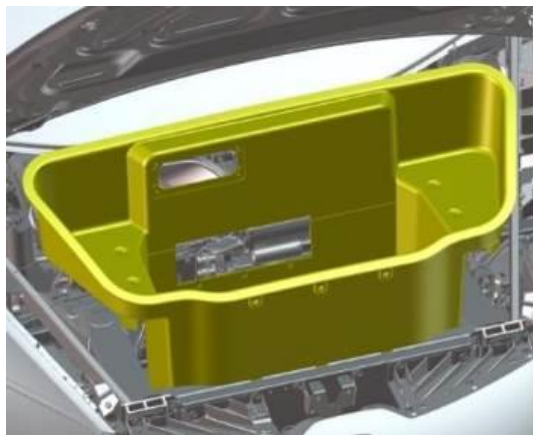

G. Removing/Installing the cowl top cover side cover, left and right



ATTENTION

This procedure can be used on both the right and the left sides.

13. Remove the 8 screws.



Notes for re-installation.

Tighten the screw.

Tightening torque: **2,50 Nm (1,84 lbf ft) ± 20%.**



14. Remove the side cover.


H. Removing/Installing the lifting system compressor




ATTENTION

Before proceeding, relieve the pressure from the system using the pressure relief valve


15. With the vehicle on the floor:
- lower the lifting system completely;
 - remove the valve;
 - wait a few seconds.

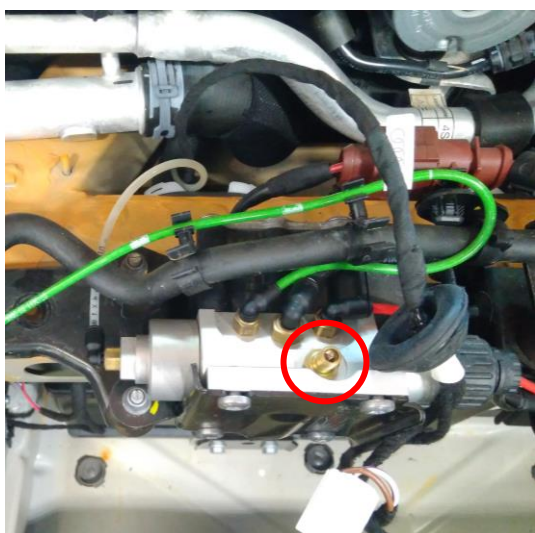

16. Disconnect the tubes from the compressor valve unit.

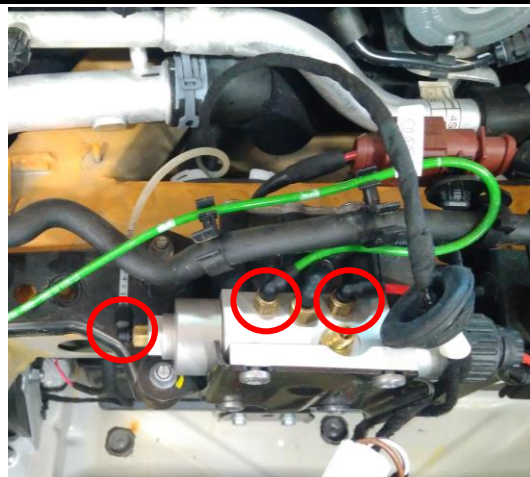

17. Disconnect the three connectors.

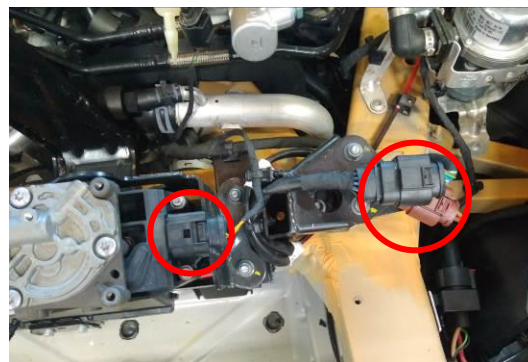

18. Remove the 2 screws.



Notes for re-installation.

Tighten the screw.

Tightening torque: 30 Nm (22,13 lbf ft) $\pm$ 20%.



19. Remove the compressor unit.



I. Removing/Installing the right windshield wiper reinforcement bracket

20. Remove the 4 screws.



Notes for re-installation.

Tighten the screw.

Tightening torque: 9 Nm (6,64 lbf ft) $\pm$ 20%.



21. Remove the bracket.



J. Procedure for replacing bracket protection of ABS-ESP control unit

22. Disconnect the pipes from their fixing clip.



23. Disconnect the pipe.



24. Remove the old protections.



25. Install the new protection.



L62X- A.05.18	To: Official After Sales Network Subject: Bracket protection upgrade Date: 18 June 2018 Pages 9	
--------------------------	--	--



K. Reinstall

26. To reinstall follow the removal procedure in reverse order.

For any further information do not hesitate to contact the Technical Support.

Kind Regards,
Customer Service

Rev.01	The information and procedures published below are strictly confidential and intended exclusively for authorized operators and individuals. All copyrights are the property of Automobili Lamborghini S.p.A based on copyright law. The company reserves the right to make updates and modifications. The reprinting, reproduction, forwarding to unauthorized people and/or to third parties and partial or entire translation thereof are prohibited without written authorization from Automobili Lamborghini S.p.A. doc. nr: L/V6_M06 Rev.[04]	9/9
--------	--	-----