

**\* \* TECHNICAL INFORMATION NOTICE \* \***

DATE: October 3, 2018  
TO: Mitsubishi Motors US and Puerto Rico Service and Parts Managers  
RE: Engine ECU Software Update in TSB-18-13-001 & TSB-18-13-002 Addresses Both  
DTC P0068 & P061A  
TIN NO. TIN-18-13-003

.....

**AFFECTED VEHICLES:** 2018 Eclipse Cross

**PURPOSE**

To maximize customer satisfaction with the all new Eclipse Cross, please perform the Engine ECU reprogramming outlined in TSB-18-13-001 and TSB-18-13-002 on **any affected Eclipse Cross in your new or used vehicle inventory, or one that visits your dealership service department.**

This Engine ECU software update was made available on June 7, 2018 to address MFI DTCs P0068 and P061A that have been improperly set. **The Engine ECU only needs to be flashed once with the updated software, to address both MFI DTCs.**

When reprogramming the Engine ECU software to resolve DTC P0068 or P061A, be sure to first check the software part number as described in TSB-18-13-001 and TSB-18-13-002.

If the Software Part Number listed is 1860D11603 or higher, then the software update for P0068 and P061A has been completed. There is no need to complete the procedure in both TSBs, as software level 1860D11603 addresses both issues.

Many of the vehicles affected by SR-18-007 (FCM-ECU Reprogramming) and/or SR-18-008 (ASC Hydraulic Unit ECU Reprogramming) may not have received this Engine ECU software upgrade yet – it will be a good opportunity to reprogram the Engine ECU when the vehicle is brought in to have SR-18-007 and/or SR-18-008 completed.

Always obtain the customer's approval before completing the Engine ECU reprogramming on a customer owned vehicle.