

Noise Symptom - Exterior Mirrors (I-no.: 258/259/260/261) Make Squeaking Noise When Folding In/Out: Replacing joint gap seal (SY 80/18)

Model Line: **Panamera (971)**

Model Year: **As of 2017 up to 2019**

- Equipment:
- **Electrically retractable exterior mirrors (I-no. 258)**
 - **Electrically retractable exterior mirrors with memory (I-no. 259)**
 - **Electrically retractable exterior mirrors with automatic dimming (I-no. 260)**
 - **Electrically retractable exterior mirrors with automatic dimming and memory (I-no. 261)**

Subject: **Exterior mirror seal**

Symptom: **Exterior mirror can make squeaking noises when folding in and out.**

Cause: The exterior mirror can squeak when folding in and out due to the sealing geometry of the joint gap seal between the mirror base and mirror housing. This can occur particularly at temperatures above 68° F (20° C).

Remedial Action: Replace the existing joint gap seal with the new seal with modified sealing geometry, see ⇒ *Workshop Manual '667919 Removing and installing rear-view mirror housing (lower part)'*.



Information

The following points must be observed in relation to the part numbers listed below and the relevant vehicle (depending on equipment):

- **Particular/modified components**, whose part numbers are listed accordingly, are **required for the remedial action**.
- **Part number indexes will increase over time**. Before performing repairs, cross reference with PET (Porsche Spare Parts Catalog), for newer parts (higher index).
- **PET must be checked** to determine if additional components are needed.

Parts Info: **971.857.555.B** ⇒ Seal (bottom left)
971.857.556.B ⇒ Seal (bottom right)

Invoicing: The work involved is invoiced under the labor operation:

APOS	Labor operation	I No.
66791903	Removing and installing rear-view mirror housing (left)	
66791904	Removing and installing rear-view mirror housing (right)	

For invoicing and documentation using PQIS, enter the following coding:

Location (FES5)	66790	Exterior mirror housing
Damage type (SA4)	2000	Noises

References: ⇒ *Workshop Manual '667919 Removing and installing rear-view mirror housing (lower part)'*

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2018 Porsche Cars North America, Inc.