



## Preliminary Information

### PIP5603 Possible Check Engine Lamp on With DTC P00C7 and P0106 High Mileage Vehicles

Proactive

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Volt	2016 - 2019	All	All	1.5 L3A	All


<b>Involved Region or Country:</b>	North America
<b>Additional RPO/s:</b>	None
<b>Condition:</b>	High mileage vehicles may experience a check engine lamp with DTC P00C7 and P0106 set as current or in history
<b>Cause:</b>	Possible plugged PCV orifice

**Correction:**

Perform latest diagnostics in service information for DTC P00C7 P0106.

If the published diagnostics do not isolate the root cause perform the following.

Remove the camshaft cover assembly and inspect the PCV orifice for being restricted. (Photo below is showing actual PCV orifice)

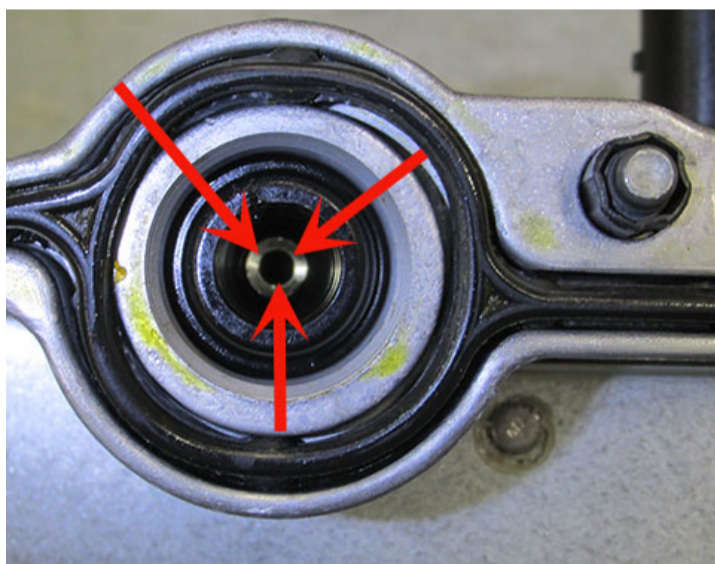

If you find the above PCV orifice is plugged or restricted use a 1.8mm drill bit (hand use only) to clear the orifice.

Reassemble the engine using a new camshaft cover gasket and retest.

Warranty Information

Labor Operation:	Description	Labor Time:
4060930	Camshaft Cover Replacement	Use Published Labor Time

Version History

Version	1
Modified	10/26/2018 - Created on

