



Preliminary Information

PIT5606B Intermittent No Crank, No Start, or Reduced Power loss of data multiple U codes or Power door locks intermittently or completely inoperative.

Product Investigation Review Required

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
GMC	Acadia	2017 - 2018	All	All	All	All
Cadillac	XT5	2017 - 2018	All	All	All	All

Involved Region or Country	North America
Condition	Intermittent No Crank, No Start, or Reduced Power loss of data multiple U codes or intermittent Power Door Locks inoperative with DTC's B3125, B3130, B3135.
Cause	IP harness chaffed at base of steering column, by the I-shaft. We have also seen these DTC's set with back ed up water in the HV AC module leaking on the BCM connectors.

Correction:

Inspect IP harness at base of steering column, by the I-shaft. If the harness is chaffed, repair damaged wires and zip tie the harness away from the I-shaft.

Also Inspect the HVAC drain hose is properly routed and not plugged if water is leaking in to the BCM.

Engineering is looking in to the concern and the PI will be updated when more information is available.

Note: Customer may state they could not open the door.

Advised to look at their owner's manual.

To lock/unlock the doors from inside the vehicle: Pull once on the door handle to unlock the door and again to open the door.

Warranty Information

For wiring repairs covered under warranty, please refer to latest version of bulletin [10-00-89-005](#) for warranty information on wire/connector repairs.

Additional SI Keywords

cluster, code, codes, communication, damage, detection, drain, gauge, gauges, heat, heated, hose, inop, inoperative, intermittent, intermittently, IPC, leaking, lock, loss, messages, module, object, plugged, radio, seat, seats, steering, SUFS, U, U0001, U0002, U0020, U0073, U0074, U0077, U0100, U0101, U0102, U0109, U0121, U0125, U0126, U0128, U0130, U0131, U0140, U0151, U0155, U0158, U0159, U0164, U0167, U0168, U0170, U0181, U0182, U0184, U0186, U0193, U0198, U0201, U0203, U0204, U0207, U0208, U0209, U0210, U0232, U0233, U0236, U0237, U023A, U0255, U0256, U0257, U0264, U0265, U0268, U0269, U026A, U026B, U180D, U1826, U1827, U1833, U183A, U184A, U184B, U184C, U184D, U184E, U18A3, U2099, U209E, U209F, U2100, U2101, U2103, U2105, U2106, U2107, U2108, U2125, U212,7 U2144, unwanted, water, wires, wiring, XT5,

Version History

Version	3
---------	---

Modified

01/12/2018 Created on
03/09/2018 Updated correction information
10/29/2018 Updated to add keywords



© 2018 General Motors. All Rights Reserved.