

# TECHNICAL BULLETIN

19 SEP 2018

© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

#### INFORMATION

## SECTION:

204-02

## SUBJECT/CONCERN:

'Creak'/'Squeak' Noise From Rear of the Vehicle

## AFFECTED VEHICLE RANGE:

MODEL:	MODEL YEAR:	VIN:
Range Rover Evoque (LV)	2012 Onwards	600000 Onwards

#### MARKETS:

NORTH AMERICA

## CONDITION SUMMARY

### SITUATION:

A 'creak' or 'squeak' noise may be evident from the rear of the vehicle, more noticeable on uneven road surfaces and during cold ambient temperatures.

#### CAUSE:

This may be caused by incorrect stabilizer bush dimensions. Suggested customer concern code - GU6.

# ACTION:

Should a customer express this concern, follow the Workshop Procedure below.

# PARTS:

## LTB01173NAS1 - 'Creak'/'Squeak' Noise From Rear of the Vehicle | TOPIx

PART NUMBER	DESCRIPTION	QUANTITY
LR113771	Rear stabilizer bar bush	2
RYG500470	Bolt	4

T00LS:

Refer to Workshop Manual for any required special tools.

# WARRANTY:

# △ NOTES:

- Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only.
  Always refer to JLR claims submission system to obtain the latest repair time.
- The JLR Claims Submission System requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Rear stabilizer bar bush - set - renew	64.35.18	0.3	42	LR031310

# 

Normal Warranty procedures apply.

#### SERVICE INSTRUCTION

Renew the rear stabilizer bar bushings (see TOPIx Workshop Manual section 204-02: Rear Suspension - Removal and Installation - Rear Stabilizer Bar Bushing).