



LTB01214NAS1

# TECHNICAL BULLETIN

19 SEP 2018

© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

**INFORMATION**

**SECTION:**

417-01

**SUBJECT/CONCERN:**

Rear Lamp Stain, Tarnish, And/Or Contamination

**AFFECTED VEHICLE RANGE:**

MODEL:	MODEL YEAR:	VIN:
Range Rover (LG)	2018 Onwards	380237 Onwards

**MARKETS:**

NORTH AMERICA

**CONDITION SUMMARY:**

**SITUATION:**

The rear lamp(s) may exhibit signs of staining, tarnishing, and/or contamination on the inner surface of the lens.

**CAUSE:**

This may be caused by moisture freezing on the anti-fog coating applied to the inner surface of the rear lamp lens.

**ACTION:**

Should a customer express this concern, refer to the Service Information and then follow the Workshop Procedure below.

**PARTS:**

PART NUMBER	DESCRIPTION	QUANTITY
-------------	-------------	----------

PART NUMBER	DESCRIPTION	QUANTITY
LR122371	Rear lamp - Right - NAS	1
LR122376	Rear lamp - Left - NAS	1
LR122370	Rear lamp - Right - NAS - SVO	1
LR122374	Rear lamp - Left - NAS - SVO	1

**TOOLS:**

Refer to Workshop Manual for any required special tools.

**WARRANTY:**

- NOTES:**
- Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to JLR claims submission system to obtain the latest repair time.
  - The JLR Claims Submission System requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Rear lamp - One - Renew	86.40.70	0.2	D4	LR098353
Rear lamp - Both - Renew	86.40.70.01	0.4	D4	LR098353

**NOTE:**  
Normal Warranty procedures apply.

**SERVICE INFORMATION:**



Staining, tarnishing, and/or contamination on the outer lens.

## WORKSHOP PROCEDURE:

- 1 Inspect the rear lamps.
  - If there are not signs of staining, tarnishing, and/or contamination, continue further diagnosis (see TOPlx Workshop Manual section 417-01: Exterior Lighting - Description and Operation).
    - Do not continue with this Technical Bulletin.
  - If there are signs of staining, tarnishing, and/or contamination, go to Step 2.
- 2 Renew the affected rear lamp(s) (see TOPlx Workshop Manual section 417-01: Exterior Lighting - Removal and Installation - Rear Lamp Assembly).