

Fuel Tank Is Difficult To Fill

Topic number	LI47.10-P-068893
Version	1
Function group	47.10 Fuel tank
Date	10-04-2018
Validity	BR205; BR253; BR213; BR238; BR257 with OM626; OM651; OM642; OM654; OM656 As of production date 10/2017
Reason for change	
Reason for block	

Complaint:

The fuel tank is difficult to fill. The pump nozzle shuts off prematurely.

Cause:

A sealing boot installed between the incorrect fueling protector and the filler neck has detached.

See attachment for pictures.

This sealing boot obstructs the flow in the filler neck behind the incorrect fueling protector. Due to this, the diesel fuel cannot flow freely into the fuel tank, which causes the pump nozzle to keep shutting off.

Attachments	
File	Description
Bilder.pdf	Pictures of sealing boot

Remedy:

The sealing boot must be removed from the filler neck. It is not necessary to replace any components.

Symptoms
Power generation / Fuel system / Fuel tank / Function / Cannot be filled up properly

Validity		
Vehicle	Engine	Transmission
C (205)	626	*
C (205)	651	*
C (205)	654	*
CLS (257)	656	*
CLS (257)	654	*

XENTRY TIPS

E (213)	656	*
E (213)	642	*
E (213)	654	*
E (238)	656	*
E (238)	642	*
E (238)	654	*
GLC (253)	651	*
GLC (253)	642	*