



## Technical Tip

<b>Topic</b>	01-18-11TT - DTC P013E O2 Sensor Bank 1 Sensor 2 Delayed Response - Rich to Lean Stored in ECM Fault Memory
<b>Market area</b>	United States 444 Volkswagen of America, Inc. (6444)
<b>Brand</b>	Volkswagen
<b>Date</b>	August 3, 2018

## Condition

**ATTENTION:****THIS IS A TECH TIP, NOT A TECHNICAL BULLETIN.****TECH TIPS ARE NOT ASSOCIATED WITH WARRANTY CLAIMING.**

### DTC P013E O2 Sensor Bank 1 Sensor 2 Delayed Response - Rich to Lean Stored in ECM Fault Memory

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Jetta	2017	1.4L (CZTA)	All	All	All

## Technical Background

The fault may be caused by an exhaust leak or a failed catalytic converter. The rear oxygen sensor may have been replaced previously.

## Service

Closely inspect for exhaust leaks from the turbocharger to the rear oxygen sensor. If leaks are identified, repair as necessary. If no leaks are found, replace the catalytic converter.

## Additional Information

### Revision History

Revision Number	Released Date	Reason For Update
2052088/1	8/3/18	Original publication.

© 2018 Volkswagen Group of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.