



Volkswagen

Service Information

Offboard Diagnostic Information System Service (ODIS Service)

Number: VOS-18-15

Subject: Software Version Update, Enhancements and Fixes

Date: Aug. 17, 2018

Supersedes VOS-18-14 due to new Diagnostic Content Version

The following ODIS Service software versions are available for download.

Current ODIS Service Software Versions	
Application: V4.4.10	Diagnostic Content: V2.36.3

The following fixes are highlights only. For complete details, please refer to the Release Notes after installing the update.

AU - Golf 2013 > only USA/Canada:

- The pedal path of the clutch position sensor was not properly detected in test plan G476_5G_1_0212_11_00011 even from known good working vehicles.
- Test SYS_X_1_0616_11_X_X_VAU_OT_FSB_Aussetzer_00000 checking for combustion interruption - step for spontaneous ignition - asks if the spark plugs are the correct thermal value. Spark plugs should be replaced if not the correct thermal value:
 - Answer "Yes": Replace the spark plugs.
 - Answer "No": Test continues to check for increased oil consumption.
- DTC U109300 test plan SYS_X_J965_1_0914_11_Leitungspruefung_00000 tests pin 26 at the access and start module -J965- for the awakening wire.
 - Pin 10 is for the awakening wire.
 - Pin 26 is for the passenger Kessy door handle antenna

CA – Atlas USA/Canada:

On vehicles with Passenger Occupied Detection System, DTC B101614: Front passenger side airbag disabled indicator lamp open circuit/short circuit to ground test K145_X_1_0312_11_00011 says to shut off passenger airbag with switch -E224-.

Misc. general translation errors.

To identify versions currently installed on a diagnostic device, please refer to **ODIS Service – Service Information** document title: **Online Update Guide – Section 4.0**