



Technical Tip

Topic	17-18-01TT - DTC P168C Oil Pressure Switch 3 Implausible Signal during Engine Operation Stored in the Engine/Motor Control Module -J623- After Oil Filter Housing Replacement
Market area	United States 444 Volkswagen of America, Inc. (6444)
Brand	Volkswagen
Date	October 12, 2018

Condition

ATTENTION:

THIS IS A TECH TIP, NOT A TECHNICAL BULLETIN.

TECH TIPS ARE NOT ASSOCIATED WITH WARRANTY CLAIMING.

DTC P168C Oil Pressure Switch 3 Implausible Signal during Engine Operation Stored in the Engine/Motor Control Module -J623- After Oil Filter Housing Replacement

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Tiguan LWB	2018	2.0L (DGUA)	All	All	All

Technical Background

A new oil filter housing does not come with the oil control mechanical valve. Replacement of the housing without this valve will generate fault P168C.

Service

Inspect the old filter housing and if present, install the mechanical valve into the new housing.



Figure 1



Additional Information

Revision History		
Revision Number	Released Date	Reason For Update
2052658/1	10/12/18	Original publication.

© 2018 Volkswagen Group of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.