

## **Technical Tip**

| Topic       | 55-18-01TT - Rear Lid Does Not Operate or Does Not Operate Correctly |  |
|-------------|--|--|
| Market area | rea United States 444 Volkswagen of America, Inc. (6444)             |  |
| Brand       | Volkswagen   |  |
| Date        | October 5, 2018  |  |

## **Condition**

#### **ATTENTION:**

THIS IS A TECH TIP, NOT A TECHNICAL BULLETIN.

TECH TIPS ARE NOT ASSOCIATED WITH WARRANTY CLAIMING.

#### Rear Lid Does Not Operate or Does Not Operate Correctly

| Model(s) | Year | Eng. Code | Trans. Code | VIN Range From | VIN Range To |
|----------|------|-----------|-------------|----------------|--------------|
| Atlas    | 2018 | All       | All         | All            | All          |

# **Technical Background**

The rear lid will not electrically open all of the way or may not electrically move at all. Trunk lamps may be inoperative. Also, interior lamps may not operate when opening the doors or may work after opening and closing the door several times. There may not be any stored faults.

### **Service**

Begin by unplugging the trunk lamps and retesting rear lid operation.

If the lid now operates properly:

Check the part number of the lamps with the parts department.

As a test:

Swap lamps from a working vehicle.

If operation is restored:

Replace the lamps.

If the issue is still present:

Check the MVB for the lid lock motor.

If not reading correctly:

Check wiring and replace the lock motor as needed.

If the MVB read correctly but the condition still exists:

Monitor MVB for the position sensors, for evidence that there is an issue.

Swap a rear lid lock motor assembly with a working vehicle to test.



## **Additional Information**

| Revision History |               |                       |  |  |  |  |
|------------------|---------------|-----------------------|--|--|--|--|
| Revision Number  | Released Date | Reason For Update     |  |  |  |  |
| 2052612/1        | 10/5/18       | Original publication. |  |  |  |  |

© 2018 Volkswagen Group of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.

2