



Technical Journal

TITLE:

Left engine pad click sound

REF NO: TJ 33442.4.0	ISSUING DEPARTMENT: Technical Service	CAR MARKET: United States and Canada	
PARTNER: 3 US 7510 Volvo Car USA		ISSUE DATE: 2018-07-10	STATUS DATE: 2018-07-17
FUNC GROUP: 2180	FUNC DESC: Engine mounting	Page 1 of 2	

“Right first time in Time”

Attachment

File Name	File Size
256 Click sound from drive shaft.mp4	5.4350 MB

Vehicle Type

Type	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
256							2016-2099		-	201505-209952

CSC Customer Symptom Codes

Code	Description
F3	Complete vehicle/Unusual noise/During acceleration
F2	Driving/Unusual noise/During acceleration

VST Operation Number

VST Operation Number	Description
21815	Engine pad left replace

DTC Diagnostic Trouble Codes

Rows beginning with * are modified

Note! If using a printed copy of this Technical Journal, first check for the latest online version.



Text

DESCRIPTION:

* New service solution.

If the vehicle has a click sound from the left engine pad, follow the advice under "Service".

Make sure that the sound is coming from the engine pad, NOT from the drive shaft. This is a different sound. See [attachment](#).

SERVICE:

* Replace sems screws (4) from engine mount to body with new P/N 30640918. Torque 60nm.

VEHICLE REPORT:

Yes, please submit a Vehicle Report if click sound returns after repair. Use concern area "Vehicle Report" and sub concern area "Support not needed", use function group 2180.

This TJ has one sound file attachment.