VOLVO CAR SERVICE AND PARTS BUSINESS



Technical Journal

TITLE: Steering wheel off center

REF NO:	ISSUING DEPARTMENT:	CAR MARKET:		
TJ 33715.2.0	Technical Service	United States and Canada		
	PARTNER:	ISSUE DATE:	STATUS DATE:	
3 US 7	7510 Volvo Car USA	2018-05-08	2018-05-11	
FUNC GROUP:	FUNC DESC:			
6410	Steering wheel, column lock, steering co	Page 1 of 3		

"Right first time in Time"

Attachment

File Name	File Size
TJ 33715.jpg	0.1113 MB

Vehicle Type

Туре	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
536						2019-9999		0000001-99999999	201746-999952

CSC Customer Symptom Codes

Code	Description
QE	Steering wheel/Steering wheel spokes not correctly positioned

VST Operation Number

VST Operation Number	Description			
88425-2	Driver's airbag (SRS) remove-install / replace			
64104-2	Steering wheel replace (steps 2-4)			
60110-2	Wheel angles 4 wheels calibrating			

DTC Diagnostic Trouble Codes

Rows beginning with * are modified

Note! If using a printed copy of this Technical Journal, first check for the latest online version

Produced in the USA and available as an electronic document. Hard copy documents are printed in USA on recycled paper containing a minimum of 50% wastepaper and 10% post-consumer waste. © 2018 VOLVO CAR USA, LLC



Text

DESCRIPTION:

If steering wheel is off center while driving straight forward, then follow Service below.

The steering wheel is always positioned correctly at the assembly line, but if the steering wheel is removed for various adjustments it may not be reinstalled correctly on the steering column.

SERVICE:

- 1. Remove driver's airbag according to VIDA (VCC-ID: VCC-502656-1)
- 2. Remove the screw for steering wheel according to VIDA (VCC-ID: VCC-502279-1)
- 3. Align the steering wheel to the steering column, follow the markings according to picture TJ 33715.jpg
- 4. Reinstall all parts according to VIDA (torque screw 60 N)
- 5. Perform a wheel alignment on front wheels according to VIDA (VCC-ID: VCC-502859-1)
- 5. Verify repair

VEHICLE REPORT:

Yes, please submit a Vehicle Report if the service solution described in this TJ has no effect, or if the structure week is 201814 or later.

Use concern area "Vehicle Report" and sub concern area "Support not needed", use function group 6410.

To view TJ attachment continue to next page. This TJ has one attachment.



Technical Journal 33715.2.0

