



Technical Service Bulletin

01 MIL on, DTC P261000 or P006800 or P227900 stored in the ECM - 2.0 TFSI

01 18 82 2045222/3 August 20, 2018. Supersedes Technical Service Bulletin Group 01 number 17-96 dated January 18, 2017 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A4	2016 - 2017	All	Not Applicable

Condition

REVISION HISTORY		
Revision	Date	Purpose
3	-	Revised title (Updated fault codes and format) Revised <i>Warranty</i> (Updated Labor Operation)
2	01/18/2017	Revised header data (Added customer codes)
1	09/22/2016	Initial publication

The customer's concern states that a MIL light has appeared:

- Exhaust emissions warning lamp on

Workshop findings:

At least one of the following DTCs is stored in the engine control module (ECM), J623 (address word 0001):

- DTC P006800** (intake manifold pressure/air mass quantity <-> throttle valve angle deviation)

Or

- DTC P227900** (air leaks in intake system)

Or

- DTC P261000** (counter for parking time, malfunction)

Technical Background

OBd diagnostics too sensitive.

Production Solution

New software in the engine control module (ECM), J623 (address word 0001) addressed the condition.



Technical Service Bulletin

Service

SVM Update Instructions

1. Follow all instructions in TSB 2011732: *00 Software Version Management (SVM), operating instructions.*
2. Update the engine control module (ECM), J623 (address word 0001) using the SVM action code as listed in the table below if necessary:

Model	Engine	Old Software Part Number	Old Software Version	New Software Part Number	New Software Version (or higher)	SVM Code Input
A4 (B9)	CYMC	8W0906259C	0001-0004	8W0906259C	0005	01A221

Warranty

Claim Type:	<ul style="list-style-type: none">• 110 up to 48 Months/50,000 Miles.• G10 for CPO Covered Vehicles – Verify Owner.• If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	2470		
Damage Code:	0039		
Labor Operations:	Software Update	0151 0000	Time stated on diagnostic protocol (Max 50 TU)
Diagnostic Time:	GFF	No allowance	0 TU
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	No allowance	0 TU
Claim Comment:	As per TSB # 2045222/3		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.



Technical Service Bulletin

Additional Information

The following Technical Service Bulletin(s) will be necessary to complete this procedure:

- TSB 2011732, *00 Software Version Management (SVM), operating instructions.*

All parts and service references provided in this TSB (2045222) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2018 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.