

Technical Service Bulletin

01 MIL on, DTC P25B400 stored in the ECM

01 18 83 2052094/1 August 24, 2018.

| Model(s) | Year | VIN Range | Vehicle-Specific Equipment |
|----------|------|-----------|----------------------------|
| RS 5 | 2018 | All | Not Applicable |

Condition

Customer states:

• MIL on.

Workshop findings:

The following DTC can be found in the engine control module (ECM), J623 (address word 0001):

DTC P25B400 (Turbocharger/Supercharger Wastegate "A" Stuck Closed).



Note:

If technical issues found with turbocharger when performing GFF, this TSB does not apply.

Technical Background

Software wastegate diagnosis incorrectly sets fault, there are no issues with the vehicle.

Production Solution

Software with improved wastegate diagnostics.

Service

SVM Update Instructions

- 1. Follow all instructions in TSB 2011732: 00 Software Version Management (SVM), operating instructions.
- 2. Update the engine control module (ECM), J623 (address word 0001) using the SVM action code as listed in the table below, if necessary:



Technical Service Bulletin

| Model | Engine and/or Transmission | Old Software Part Number | Old Software Version | New Software Part Number | New Software Version (or higher) | SVM Code Input |
|------------|-------------------------------|-----------------------------|----------------------------|-----------------------------|--|-------------------|
| RS 5 (all) | DECA | 8W0907551A | < 0003 | 8W0907551A | 0003 | 01A248 |

Warranty

| Claim Type: | 110 up to 48 Months/50,000 Miles. G10 for CPO Covered Vehicles – Verify Owner. 1E1 up to 8 Years/80,000 Miles. If vehicle is outside any warranty, this Technical Service Bulletin is informational only. | | | | | | |
|-------------------|--|--------------|---|--|--|--|--|
| Service Number: | 2470 | | | | | | |
| Damage Code: | 0039 | | | | | | |
| Labor Operations: | Connect battery charger and perform software update with SVM | 2470 2599 | 50 TU | | | | |
| Diagnostic Time: | GFF | 0150 0000 | Time stated on diagnostic protocol (Max 40 TU) | | | | |
| | Road test prior to service procedure | No allowance | 0 TU | | | | |
| | Road test after service procedure | No allowance | 0 TU | | | | |
| Claim Comment: | As per TSB #2052094/1 | | | | | | |

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

The following Technical Service Bulletin will be necessary to complete this procedure:

• TSB 2011732, 00 Software Version Management (SVM), operating instructions.



Technical Service Bulletin

All parts and service references provided in this TSB (2052094) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2018 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.