



Technical Service Bulletin

69 Airbag warning light on, DTC B1225F1 stored in the airbag control module

69 18 36 2051242/1 August 24, 2018.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A4, Q7	2017 - 2018	All	Not Applicable
A5 Cabriolet	2018	All	Not Applicable

Condition

Customer states:

- Airbag warning lamp illuminated in driver information system (DIS).
- Customer may also report that the passenger airbag indicator lamp in overhead console may show the airbag is off.

Workshop findings:

The following DTC is stored in the airbag control module, J234 (address word 0015):

- **DTC B1225F1** (Seat occupied recognition sensor mat Shield wire, open circuit).

Technical Background

Not applicable.

Production Solution

There is a concern with the aluminum shielding on the PODS harness under the seat that is causing the DTC B1225F1 to occur. The aluminum sleeve isn't fitted tight enough to the harness, a small amount of interference is possible and causes the fault.

The service solution is to apply cable ties at two different points of the harness under the seat which tightens the fit of the aluminum shielding and corrects the issue.



Technical Service Bulletin

Service

1. To apply the cable ties, the seat does not need to be removed. You will need to move the lateral seat adjustment all the way to rear most adjustment limit and the vertical height adjustment all the way to the upper adjustment limit.

Once the seat is adjusted to the above mentioned position, you will see need to attach the cable tie at two points on the harness as shown (Figure 1):


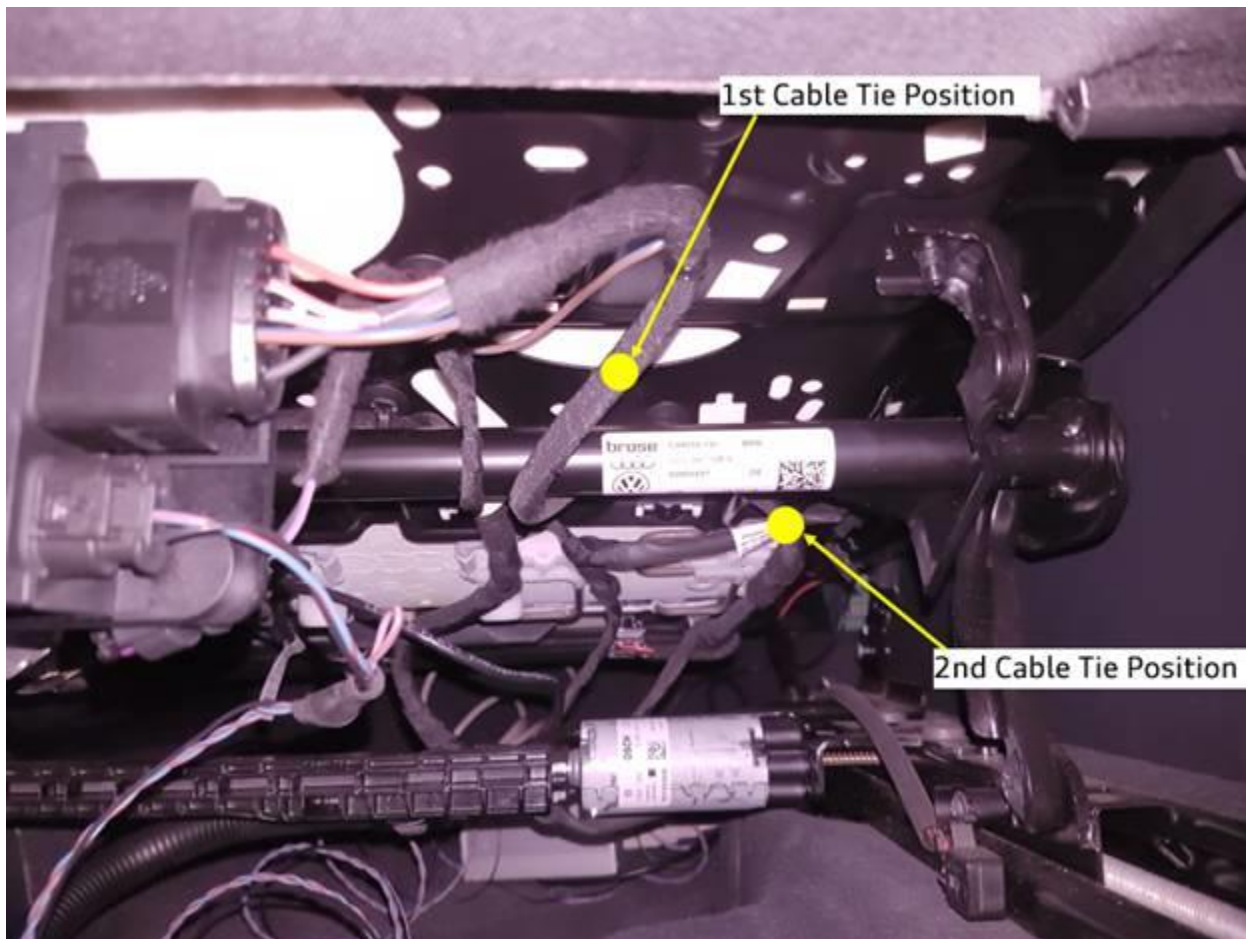


Figure 1. Positions of the cable ties.

2. You will attach the first cable tie in the yellow marked area on the harness between the cable tie clip and the crossbar tube as shown below (Figure 2):

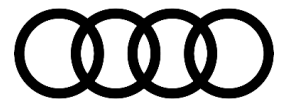

Technical Service Bulletin



Figure 2. Attach the first cable tie in the yellow area.

3. The second cable tie position is to the rear of the crossbar tube where the harness drops down from the frame. Place the cable tie in the yellow marked area shown below (Figure 3):



Technical Service Bulletin



Figure 3. Attach the second cable tie to the yellow marked area.



Note:

When tightening the cable ties, only tighten them with your hands, do not use any tools to tighten the cable tie as this can damaged the harness.

4. Once you have the cable ties properly secured and installed, return the seat to the original position and clear the faults stored in the system.



Technical Service Bulletin

Warranty

Claim Type:	<ul style="list-style-type: none">• 110 up to 48 Months/50,000 Miles.• G10 for CPO Covered Vehicles – Verify Owner.• If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	7210		
Damage Code:	0018		
Labor Operations:	Seat Wiring Harness Repair	7210 9999	25 TU
Diagnostic Time:	GFF – Checking and clearing fault codes	0150 0000	20 TU
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	No allowance	0 TU
Claim Comment:	As per TSB #2051242/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Required Parts and Tools

Always check with your Parts Department and/or ETKA for the latest information and parts bulletins.		
Part Number	Part Description	Quantity
N 909 377 02	Cable strap	02
See ETKA	Fasteners, Bolts, Nuts and Screws as needed per the Repair Manual	See ETKA/ELSA

Additional Information

All parts and service references provided in this TSB (2051242) are subject to change and/or removal.

©2018 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.