

Service Campaign Bulletin



Mercedes-Benz

Campaign No. 2018030007, April 2018

TO: ALL MERCEDES-BENZ CENTERS

SUBJECT: **Model 205 Model Year 2018**
Replace Coolant Hose

Daimler AG ("DAG"), the manufacturer of Mercedes-Benz vehicles, has determined that on certain MY18 205 (C-Class) vehicles, the coolant hose from the oil cooler to the charge air cooler may not have been correctly installed. As a result, coolant may leak which could lead to a warning message to appear in the instrument cluster. An authorized Mercedes-Benz dealer will replace the coolant hose in the affected vehicles.

Prior to performing this Service Campaign:

- Please check VMI to determine if the vehicle is involved in the Campaign and if it has been previously repaired.
- Please review the entire Service Campaign bulletin and follow the repair procedure exactly as described.

Approximately 364 vehicles are affected.

Order No. P-SC-2018030007

This bulletin has been created and maintained in accordance with MBUSA-SLP S423QH001, Document and Data Control, and MBUSA-SLP S424HH001, Control of Quality Records.

Service Campaign Bulletin

Service Campaign Bulletin

Service Campaign Bulletin

Service Campaign Bulletin

Service Campaign Bulletin

Procedure

1. Drain and collect coolant of low-temperature circuit.

i AR09.41-P-6834LW.

2. Replace **coolant hose (140)** in low-temperature circuit from oil cooler to charge air cooler (**figure 1**).

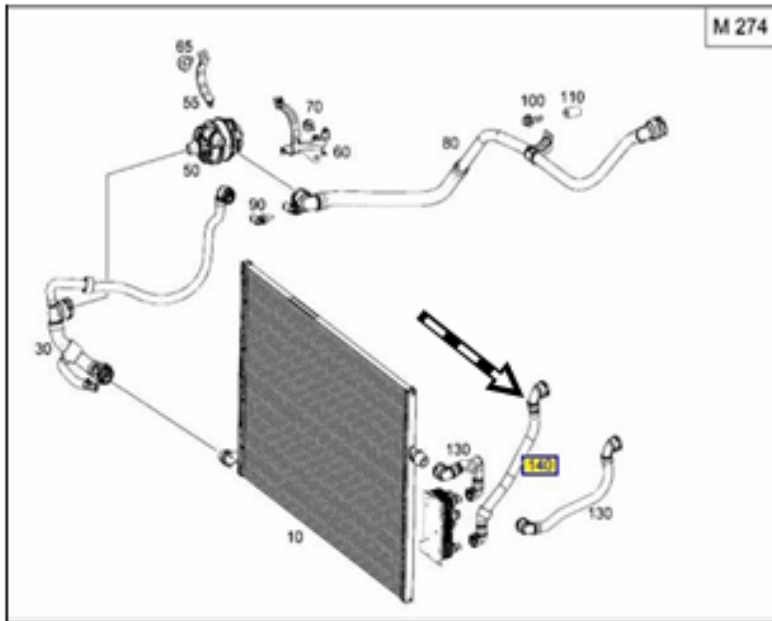


Figure 1

3. Refill collected coolant of lower-temperature circuit and correct.

i AR09.41-P-6834LW.

i Use electric vacuum pump!

Primary Parts Information

Qty.	Part Name	Part Number	Estimated Replacement Rate
1	Coolant hose	A 205 501 19 00	100%

Warranty Information

Operation: Replace low-temperature circuit coolant hose from oil cooler to charge air cooler (02-2233)

Includes: Remove/install lower front and center section of engine compartment lining

Extra work for: Remove/install engine compartment lining in vehicles with underbody protection(02-9676)

Damage Code	Operation Number	Labor Time (hrs.)
20 941 43 7	02-2233	1.1
	02-9676	ZM

i **Note** Operation Number labor times are subject to change.