

Message in instrument cluster "Unavailable! - ESP - Service Required"

Topic number	LI42.47-P-068826
Version	1
Function group	42.47 Adaptive Brake (ABR)
Date	09-24-2018
Validity	Model series 117/156/176/246
Reason for change	
Reason for block	

Complaint:

After engine start the following messages may appear alternately in the instrument cluster:

- "Unavailable! - ESP - Service Required"
- "Unavailable! - ABS - Service Required"
- "Tire Pressure Monitor Unavailable".

Note:

One of the following codes (DTC) is/are stored in the ESP control unit (N30-4):

- C04A600
- C04C600
- C04E600
- C050600

This respective code was logged when the vehicle is stationary.

Cause:

Possibly monitoring of clearance between wheel speed sensor and multipole ring.

Remedy:

Perform complete initial start-up of ESP control unit.

Note:

Code 08o must be entered in the vehicle data card in VeDoc beforehand.

Please open a VeDoc XSF ticket or send an email to mbdiagnosis@mbusa.com to request 08o be added.

All requests must contain the following:

XENTRY TIPS

- dealer code and contact person with phone number
- VIN of vehicle
- reference to this LI number as reason for SA code modification
- SA code requested

Note:

ESP software is available with DVD 07/2018.

Symptoms
Chassis/suspension / Brake system / Brakes/traction regulation system / Anti-lock brake system (ABS) / Display message
Chassis/suspension / Brake system / Brakes/traction regulation system / Electronic Stability Program (ESP) / Display message