



# Technical Service Bulletin

---

## 90 Various messages displayed, DTCs B200FF1 and/or B200FF2 stored in the camera control module

90 18 97 2052240/1 August 23, 2018.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A4, Q7	2017 - 2019	All	With multifunction camera
A5, Q5	2018 - 2019	All	With multifunction camera

## Condition

### Customer statement:

In the driver information system (DIS) one or several of the following messages are displayed:

- Audi pre sense: malfunction.
- Traffic sign detection: malfunction.
- Adaptive cruise control with congestion assistant is not available.
- Audi active lane assist: currently not available.

### Workshop findings:

One of the following DTC(s) is stored in the camera control module, R242 (address word 00A5) as either static or sporadic:

- **DTC B200FF1** (internal malfunction).
- **DTC B200FF2** (internal malfunction).

## Technical Background

During its start phase the camera recognizes a malfunction in the internal communication.

## Production Solution

Not applicable.



# Technical Service Bulletin

---

## Service

1. If only **DTC B200FF1** (internal malfunction) is logged, then replace the camera control module.
2. If both **DTCs B200FF1** and **B200FF2** are logged, then replace the camera control module.
3. If only **DTC B200FF2** (internal malfunction) is logged, proceed as follows:
  - Delete the DTC
  - If the DTC is not logged again, return the vehicle to the customer. It is not necessary to replace the front camera.
  - If the DTC stays active or is logged again, then replace the camera module.

 **Note:**

Claims with a replaced camera control modules which only had the **DTC B200FF2** once may be denied.

## Warranty

<b>Claim Type:</b>	<ul style="list-style-type: none"><li>• 110 up to 48 Months/50,000 Miles.</li><li>• G10 for CPO Covered Vehicles – Verify Owner.</li><li>• If vehicle is outside any warranty, this Technical Service Bulletin is informational only.</li></ul>		
<b>Service Number:</b>	9638		
<b>Damage Code:</b>	0040		
<b>Labor Operations:</b>	<b>All Models:</b>		
	Camera Driver Assist Sys Adjust	9638 1550	40 TU
	Preparation Driver Assist Calibration	9092 0050	30 TU
	Vehicle front + rear checked	4495 0100	70 TU
	<b>A4 and A5:</b>		
	Camera Driver Assist Sys replaced	9638 5550	60 TU
	Inside mirror remove and reinstall	6827 1900	20 TU



# Technical Service Bulletin

	<b>A5 Cabriolet:</b>		
	Camera Driver Assist Sys replaced	9638 5500	110 TU
	<b>Q5:</b>		
	Camera Driver Assist Sys replaced	9638 5500	60 TU
	2 Headlight assembly adjust <b>Or</b> 2 Headlight assembly adjust	9415 1600 <b>Or</b> 9415 1601 (LED Only)	20 TU <b>Or</b> 30 TU
	<b>Q7:</b>		
	Camera Driver Assist Sys replaced	9638 5550	20 TU
	Inside mirror removed + reinstalled	6827 1900	20 TU
	2 Headlight assembly adjust <b>Or</b> 2 Headlight assembly adjust	9415 1600 <b>Or</b> 9415 1601 (LED Only)	20 TU <b>Or</b> 30 TU
	<b>Diagnostic Time:</b>	GFF	0150 0000
Road test prior to service procedure		No allowance	0 TU
Road test after service procedure		0121 0004	10 TU
<b>Claim Comment:</b>	As per TSB #2048926/4		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

## Required Parts and Tools

Always check with your Parts Department and/or ETKA for the latest information and parts bulletins.		
Part Number	Part Description	Quantity
See ETKA	Front Camera for driver assistance programs	01



# Technical Service Bulletin

---

4M0955609	Silicone pad for front camera	01
See ETKA	Fasteners, Bolts, Nuts and Screws as needed per the Repair Manual	See ETKA/ELSA

## Additional Information

All parts and service references provided in this TSB (2048926) are subject to change and/or removal.

©2018 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.