

Service Information

Offboard Diagnostic Information System Service (ODIS Service)

Number: VOS-18-12

Subject: Software Version Update, Enhancements and Fixes

Date: July 5, 2018

Supersedes VOS-18-11 due to new Diagnostic Content Version

The following ODIS Service software versions are available for download.

Current ODIS Service Software Versions	
Application: V4.3.3	Diagnostic Content: V2.36.1

Key Fixes/Enhancements for Diagnostic Content: V2.36.1

AU - Golf 2013 > only USA/Canada 2017:

DTC B11A412: Terminal 50 Short circuit to B+ function test SPG_5G_J764_1_0412_11_Klemmen_00011 only checks wiring between ESCL -J764- and vehicle power supply -J519-. Test does not check terminal 50 wire red/black T16s/12.

7P - Touareg 2010 > only USA/Canada 2014, CNRB 3.0 L TDI-CR / 176kW BW - Tiguan 2018 USA/CAN > 2018:

G39 DTC P219600: O2 Sensor Signal Stuck Rich Bank 1 Sensor 1 function test

G39_7P_23____1_1108_11_00011. Since no malfunction was detected after wiring test, the heated oxygen sensor G39 should be replaced and not ECM as required by test.

1K/AJ - Jetta 2005 USA/CAN > 2006, 3VWSG71K86M740945:

Vehicle is automatically identified as engine code BCQ 2.5l Motronic/110 kW but the correct engine code is BGQ 2.5L. Engine code BGQ 2.5L is not in the exclusion list for the model year and could not be manually selected.

5C - Beetle 2012 > only USA/Canada 2017, CPRA 1.8l Simos / 125 kW.

G130 oxygen sensor after three way catalytic converter

G130_X_1_1112_11_allEngines_X_el_Pruefungen_00011 states the ECM is faulty and should be replaced. The correct component to be replaced is G130 and not ECM.

CA - Atlas USA/CAN > 2018.

P030000: random/multiple cylinder misfire detected test

SYS_X_1_0616_11_X_X_VAU_OT_FSB_Aussetzer_00000 leapfrog replacement 1 states to put cylinder 5 and 2 ignition coils in cylinder 1. The correct arrangement should be to replace cylinder 2 with 4: Replace cylinder 2 ignition coil with cylinder 4.

Misc.: General translation errors.

To identify versions currently installed on a diagnostic device, please refer to **ODIS Service – Service Information** document title: **Online Update Guide – Section 4.0**