



Subject

Engine Control Module (ECM) Software

Release Date

September 14, 2018

Affected Vehicles

U.S.A.: 2013-2017 MY Beetle Convertible, Beetle, Jetta and 2014-2017 MY Passat CANADA: 2013-2017 MY Beetle & Jetta and 2014-2017 MY Beetle Convertible & Passat

Check Campaigns/Actions screen in Elsa on the day of repair to verify that a VIN qualifies for repair under this action. Elsa is the <u>only</u> valid campaign inquiry & verification source.

- ✓ Campaign status must show "open."
- ✓ If Elsa shows other open action(s), inform your customer so that the work can also be completed at the same time the vehicle is in the workshop for this campaign.

Problem Description

Current ECM software may cause unintended system faults. If present, these faults could lead to illumination of the malfunction indicator light (MIL). If the MIL is on, the vehicle will not pass an emissions inspection.

Corrective Action

Update ECM software.

Parts Information

Software update only; no parts needed.

Code Visibility

On or about September 14, 2018, affected vehicles will be listed on the Inventory Vehicle Open Campaign Action report under My Dealership Reports (found on www.vwhub.com & OMD Web). A list will not be posted for dealers who do not have any affected vehicles.

On or about September 14, 2018, this campaign code will show open on affected vehicles in Elsa.

On or about September 14, 2018, affected vehicles will be identified with this campaign code in the VIN Lookup tool at www.vw.com.

Owner Notification

Owner notification will take place in September 2018. Owner letter examples are included in this bulletin for your reference.

Emissions Campaigns Requirements (CALIFORNIA ONLY) The California Air Resources Board and the Department of Motor Vehicles (DMV) require emissions-related campaigns to be completed prior to vehicle registration renewal. When campaign work is done you must provide the owner with a signed "Vehicle Emission Recall – Proof of Correction" certificate (RC EMISCAVWAU). Order certificates online via the Compliance Label Ordering portal at www.vwhub.com.

Additional Information

Please alert everyone in your dealership about this action, including Sales, Service, Parts and Accounting personnel. Contact Warranty if you have any questions.

Dealers must ensure that every affected inventory vehicle has this campaign completed <u>before</u> <u>delivery to consumers</u>.

Fill out and affix Campaign Completion Label (CAMP 010 000) after work is complete. Labels can be ordered at no cost via the Compliance Label Ordering portal at <u>www.vwhub.com</u>.

Claim Entry Instructions

After campaign has been completed, enter claim as soon as possible to help prevent work from being duplicated elsewhere. Attach the Elsa screen print showing action *open on the day of repair* to the repair order. If customer refused campaign work:

- ✓ <u>U.S. dealers:</u> Submit request via WISE under the *Campaigns/Update/Recall Closure* option.
- <u>Canada dealers:</u> Upload the repair order [signed by customer] to Volkswagen WIN/Operations/Campaign Closure.

Service Number	24DR
Damage Code	0099
Parts Vendor Code	wwo
Claim Type	Sold vehicle: 7 10
	Unsold vehicle: 7 90
Causal Indicator	Mark labor as causal
Vehicle Wash/Loaner	Do not claim wash/loaner under this action
Criteria I.D.	01 or 02
	Connect battery charger, check/updated software present, no further work required
	Labor operation: 0183 00 99 20 T.U.
	-OR-
	Connect battery charger and update Engine Control Module software
	Labor operation: 2470 25 99 50 T.U.

September 2018 24DR Page 2 of 12

Customer Letter Example (United States)

<MONTH YEAR>

<CUSTOMER NAME> <CUSTOMER ADDRESS> <CUSTOMER CITY STATE ZIPCODE>

This notice applies to your vehicle: <VIN>

Subject: Emissions Service Action 24DR - Engine Control Module (ECM) Software

Certain 2013-2017 Model Year Volkswagen Beetle Convertible, Beetle, Jetta and

Certain 2014-2017 Model Year Volkswagen Passat

Dear Volkswagen Owner,

In cooperation with the United States Environmental Protection Agency and the California Air Resources Board, we are informing you of our decision to conduct an emissions service action on certain 2013-2017 model year Volkswagen vehicles. Our records show that you are the owner of a vehicle affected by this action.

What is the issue? Current Engine Control Module (ECM) software may cause unintended system faults. If

present, these faults could lead to illumination of the malfunction indicator light (MIL). If the

MIL is on, the vehicle will not pass an emissions inspection.

What will we do? Your authorized Volkswagen dealer will update the ECM software. This work will take less than an hour to complete and will be performed for you free of charge. Please keep in mind

that your dealer may need additional time for the preparation of the repair, as well as to

accommodate their daily workshop schedule.

IMPORTANT!

Please note that if the ECM in your vehicle has been "chipped," "tuned," or otherwise modified from original factory specifications with aftermarket components and/or software, work needed to repair, replace, or return the ECM to original factory specifications is NOT

covered under this action.

What should you do? Please contact your authorized Volkswagen dealer as soon as possible to schedule this

service. To set up an appointment online, please visit www.vw.com/find-a-dealer.

Lease vehicles and address changes

If you are the lessor and registered owner of the vehicle identified in this action, please forward this letter immediately via first-class mail to the lessee within ten (10) days of receipt. If you have changed your address or sold the vehicle, please fill out the enclosed prepaid Owner Reply card and mail it to us so we can update our records.

California Vehicle Owners - California

Regulations

Important information for California regulations require that this campaign be completed prior to the time you renew your vehicle registration. Therefore, please make sure that this campaign is completed prior to the renewal of your vehicle registration, and that you furnish proof of completion to the Department of Motor Vehicles (DMV) in the form of a copy of the dealer's repair order, including a signed "Proof of Correction" certificate. You obtain this from your dealer after the campaign has been completed. Please retain the signed "Proof of Correction Certificate" with your vehicle records. DO NOT MAIL THIS FORM to the DMV, unless requested.

Can we assist you further?

If your authorized Volkswagen dealer fails or is unable to complete this work free of charge within a reasonable time, or if you should have any questions about this communication, please reach out to us using your preferred method of communication at www.vw.com/contact or by calling us at 800-893-5298.

Checking your vehicle for open Recalls and **Service Campaigns**

To check your vehicle's eligibility for repair under this or any other recall/service campaign, please visit www.vw.com/owners/recalls and enter your Vehicle Identification Number (VIN) into the Recall/Service Campaign Lookup tool.

We apologize for any inconvenience this matter may cause; however we are taking this action to help ensure your vehicle continues to meet and exceed your expectations.

Sincerely,

Volkswagen Customer Protection

Customer Letter Example (CANADA)

<MONTH YEAR>

<CUSTOMER NAME> <CUSTOMER ADDRESS> <CUSTOMER CITY STATE ZIPCODE>

This notice applies to your vehicle: <VIN>

Emissions Service Action 24DR - Engine Control Module (ECM) Software Subject:

Certain 2013-2017 Model Year Volkswagen Beetle & Jetta and

Certain 2014-2017 Model Year Volkswagen Beetle Convertible & Passat

Dear Volkswagen Owner,

This notice is sent to you in accordance with the requirements of the Canadian Environmental Protection Act, 1999. Volkswagen has determined that a defect, which relates to a prescribed emission standard, exists in certain 2013-2017 model year Volkswagen vehicles. Our records show that you are the owner of a vehicle affected by this action.

What is the issue? Current Engine Control Module (ECM) software may cause unintended system faults. If

present, these faults could lead to illumination of the malfunction indicator light (MIL). If the MIL is on, the vehicle will not pass an emissions inspection. To mitigate any potential

impact to emissions, VW is proactively releasing an ECM Software update.

What will we do? Your authorized Volkswagen dealer will update the ECM software. This work will take less

than an hour to complete and will be performed for you free of charge. Please keep in mind that your dealer may need additional time for the preparation of the repair, as well as to

accommodate their daily workshop schedule.

IMPORTANT!

Please note that if the ECM in your vehicle has been "chipped," "tuned," or otherwise modified from original factory specifications with aftermarket components and/or software, work needed to repair, replace, or return the ECM to original factory specifications is NOT covered under this action.

What should you do? In order to limit any possible inconvenience, please contact your authorized

> Volkswagen dealer as soon as possible to schedule this service. On or about September 14, 2018 the necessary repair instructions will be available to your

authorized Volkswagen dealer.

If you are the lessor and registered owner of the vehicle identified in this action, please Lease vehicles and address changes forward this letter immediately via first-class mail to the lessee within ten (10) days of

receipt. If you have changed your address or sold the vehicle, please fill out the

enclosed prepaid Owner Reply card and mail it to us so we can update our records.

Can we assist you If your authorized Volkswagen dealer fails or is unable to complete this work free of further? charge within a reasonable time, please contact Customer Relations, Monday through

Friday from 8AM to 8PM EST by phone at 1-800-822-8987 or via our "Contact Us"

page at www.vw.ca.

We apologize for any inconvenience this matter may cause; however we are taking this action to help ensure your vehicle continues to meet and exceed your expectations.

Sincerely,

Volkswagen Customer Protection

! NOTE

- Damages resulting from improper repair or failure to follow these work instructions are the dealer's responsibility and are not eligible for reimbursement under this action.
- Diagnosis and repair of pre-existing conditions in the vehicle are not covered under this action.
- See Appendix A for issues addressed under this recall.

Required Tools



Battery Tester/Charger
- GRX3000VAS(or equivalent)




Diagnostic Tester
-VAS6150X/VAS6160X(or equivalent)

Repair Instruction

Section A - Check for Previous Repair

i TIP

If Campaign Completion label is present, no further work is required.

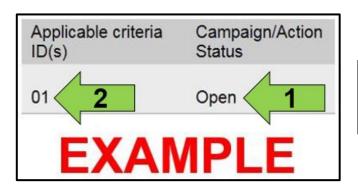

• Enter the VIN in Elsa and proceed to the "Campaign/Action" screen.

i TIP

On the date of repair, print this screen and keep a copy with the repair order.

- Confirm the Campaign/Action is open <arrow 1>.
 If the status is closed, no further work is required.
- Note the Applicable Criteria ID <arrow 2> for use in determining the correct work to be done and corresponding parts associated.

Proceed to Section B.

Section B - Repair Procedure




NOTE

Prior to launching the VAS Diagnostic Tester and starting an update, ensure the following conditions are met;


- ✓ The ODIS software is completely up to date.
 - Refer to the "Alerts" section on ServiceNet home page for the current ODIS version.
- ✓ The battery charger is connected to the vehicle battery and remains connected for the duration of the software update.
 - Battery voltage must remain above 12.5 volts for the duration of the software update. Failure to
 do so may cause the update to fail, which could result in damage to the control module. Control
 modules damaged by insufficient voltage will not be covered.
- ✓ The screen saver and power saving settings are off.
 - Failure to do so may result in the tester entering power save mode during the software update, which could result in damage to the control module.
- √ The VAS Diagnostic Tester is plugged in using the supplied power adapters.
 - Under no circumstances should the tester be used on battery power alone during the software
 update. Failure to do so may result in the tester powering off during the update, which could
 result in damage to the control module.
- If using a Bluetooth transmitter head, it is connected to the tester with a USB cable.
 - Performing a software update using a Bluetooth connection increases the risk of losing connection during the update, which could result in damage to the control module.
 It also greatly increases the time required to perform the update. Requests for additional time or parts will be denied if the GFF log shows the update was performed using Bluetooth.
- √ The Bluetooth function of the scan tool is physically switched off <see pictures below>.



VAS 6150 & VAS 6150A (Front panel behind handle)

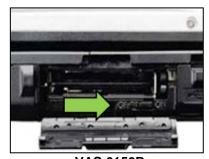

VAS 6150B (Right side behind WIRELESS door)

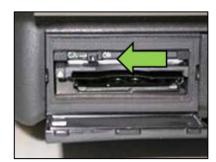

VAS 6150C/D (Left side behind SC/EX door)

A WARNING

Radiator Fan(s) may cycle ON high speed during the Update Process! There is a serious risk that personal injury may result if contact is made with spinning fan blades. Keep hands and all objects away from Radiator Fan(s) during Update Process!

i TIP

To Update-Programming using SVM, review and follow instructions in Technical Bulletin 2014603: Software Version Management (SVM) Operating Instructions.

The SVM Process must be completed in its entirety so the database receives the update confirmation response. A warranty claim may not be reimbursed if there is no confirmation response to support the claim.

- Open the hood.
- · Open the battery cover.
- Switch the ignition on.
- Apply the parking brake.
- Switch off all consumers (headlights, heated seats, climate control, etc.).
- Connect the VAS6150X/VAS6160X Diagnostic Tester to the vehicle.
- Start the ODIS program.
- Attach the GRX3000VAS Tester/Charger (or equivalent) to the vehicle battery.

• NOTE

Vehicles with Battery Monitoring Control Module -J367- and/or an EFB Battery:

When connecting the charger to the battery, connect the positive cable to the positive terminal of the battery and connect the negative cable to the grounding lug on the chassis. DO NOT connect the ground cable directly to negative terminal of the battery.

Turn the hazard warning lights on.


A CAUTION

The procedure may cancel itself if the hazard warning lights are not switched on. The hazard warning lights prevent the system from switching to bus sleep mode during the update.

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Volkswagen dealer. @2018 Volkswagen Group of America, Inc. and Volkswagen Canada. All Rights Reserved.

September 2018 24DR Page 7 of 12



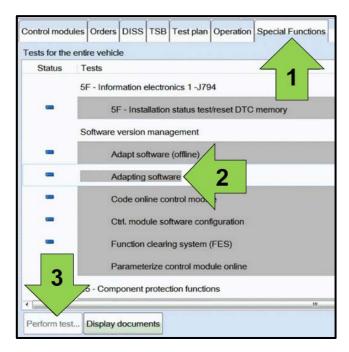





- Confirm that scan tool is communicating with the diagnostic head by USB <Green Arrow>.
 - If the Bluetooth symbol is shown <Red Arrow> then disconnect the diagnostic head from the vehicle and reconnect the USB cable to the diagnostic head and then reattach to the vehicle.
- Upon ODIS startup, verify the "Diagnosis" operating mode is selected <as shown>.
- Once the GFF scan is complete, select "Special functions" <arrow 1>, then "Adapting software" <arrow 2>, then select "Perform test" <arrow 3>.


 Select option 2 to "Update software via action code".

September 2018 24DR Page 8 of 12

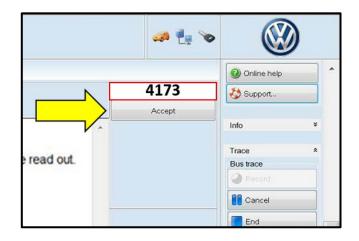

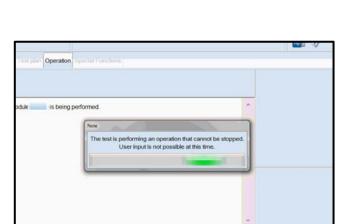



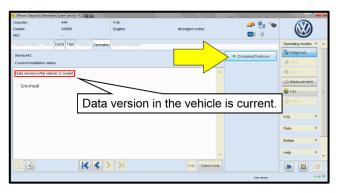



Using Bluetooth for this action is PROHIBITED!

Damage caused to electronic components (e.g. ECM, TCM, etc.) during the SVM flash process is not covered.

 Enter the corrective action code (SVM code) as listed below.

SVM code 4173

- Select "Accept" <arrow> and follow the on screen prompts.
- During the flash, this screen appears when the flash operations are performed:




If the software in the vehicle is already current, a message will appear indicating this. If this occurs, complete the ODIS test plan and send the diagnostic protocol online.


• Select Complete/Continue <arrow> after each operation is completed.

- When the SVM update is complete a confirmation message is displayed <as shown>.
- Select "Complete/Continue" <arrow>.

September 2018 24DR Page 9 of 12



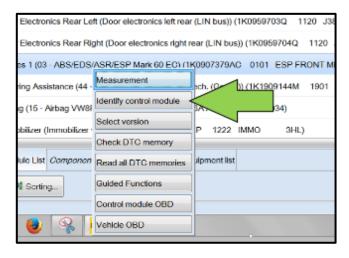

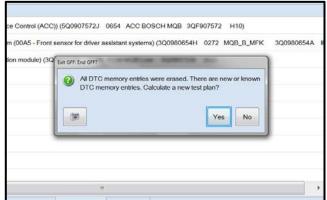

• NOTE

- It is <u>IMPERATIVE</u> that <u>ALL</u> of the ignition cycle on/off delay requests are fulfilled in their entirety during this flash process <arrow 1>.
- Failing to wait for the ignition on/off timing cycle to complete (progress bar and countdown timer <arrow 2>) before cycling the ignition on/off MAY damage a control module.
- Damage to control modules as a result of failing to wait the specified time displayed by the progress bar and countdown timer <arrow 2> are <u>NOT</u> covered under this action.
- After the software update is completed and before sending the GFF Log Online:
 - Select the "Control Module" tab.
 - Scroll down and right click on the module that was updated (0001).
 - Select "Identify Control Module" <arrow>.

 Exit GFF and send diagnostic protocol online when prompted.

U NOTE

Static communication faults may store in various control modules during the flash. These faults can only be cleared by following one of these steps:

- Drive the vehicle a short distance (around the parking lot, for example).
- After selecting "Yes", turn the ignition off for 30 seconds, turn it back on and repeat the GFF exit program.
- Clear faults using OBD (an additional key cycle may also be required).
- · Release the parking brake.
- Disconnect the VAS tester.
- Switch off and disconnect the battery charger.
- Reinstall the battery cover.

Proceed to Section C.

September 2018 24DR Page 10 of 12

Section C – Campaign Completion Label

 Fill out and affix Campaign Completion Label, part number CAMP 010 000, next to the vehicle emission control information label.

i TIP

Ensure Campaign Completion Label does not cover any existing label(s).

Proceed to Section D (California only).

Section D - California Only Requirements

CALIFORNIA ONLY Requirements for Emissions Campaigns Having Customer Notification

The California Air Resources Board and the Department of Motor Vehicles (DMV) require emissions-related campaigns to be completed prior to vehicle registration renewal. When campaign work is done you must provide the owner with a signed "Vehicle Emission Recall – Proof of Correction" certificate (RC EMIS_CAL VW). Certificates can be ordered at no cost online via the Compliance Label Ordering portal at www.vwhub.com.

i TIP

Ensure owners are aware of the importance of retaining the completed certificate for their records. It should be mailed to the California DMV *only upon request*.

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Volkswagen dealer. ©2018 Volkswagen Group of America, Inc. and Volkswagen Canada. All Rights Reserved.

September 2018 24DR Page 11 of 12

Appendix A - Topics Addressed

- Improved Lambda control.
- Deactivation of CAN Message (CAN message sent from the ECM to the TCM which the TCM does not need to process).
- Radiator shutter blockage (erroneous blockage faults).

Potential ECM Faults		
DTC	Description	
P05A0	Active Grille Air Shutter "A" Stuck On	
P05A3	Active Grille Air Shutter "A" Control Circuit Range/Performance	

Knock control faults (erroneous fault detection at idle).

Potential ECM Faults		
DTC	Description	
P039B	Cylinder 1 Pressure Too High	
P03A5	Cylinder 2 Pressure Too High	
P03AF	Cylinder 3 Pressure Too High	
P03B9	Cylinder 4 Pressure Too High	
P2336	Cylinder 1 Above Knock Threshold	
P2337	Cylinder 2 Above Knock Threshold	
P2338	Cylinder 3 Above Knock Threshold	
P2339	Cylinder 4 Above Knock Threshold	

- Improved monitoring of the fuel high pressure system.
- Improved OBD "readiness" monitoring.
- Small RPM fluctuation after engine start.
- Deactivation of two diagnostics for the frozen throttle valve "ice break function".
- Implausible gearshift when the cruise control transgresses the set speed.
- Calibration to avoid undesired gear shifts.
- Oil pressure diagnosis (not checked enough times).
- Vehicles speed limitation (set cruise control speed displayed does not increase correctly).
- Stuck open thermostat not detected.

September 2018 24DR Page 12 of 12