



Technical Tip

Topic	38-18-01TT - DTC P1701 Transmission Control Unit Locked after Mechatronic Unit Replacement
Market area	United States 444 Volkswagen of America, Inc. (6444)
Brand	Volkswagen
Date	September 7, 2018

Condition

ATTENTION:

**THIS IS A TECH TIP, NOT A TECHNICAL BULLETIN.
TECH TIPS ARE NOT ASSOCIATED WITH WARRANTY CLAIMING.**

DTC P1701 Transmission Control Unit Locked after Mechatronic Unit Replacement

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Golf, Golf Sportwagen, Golf R	2015-2017	2.0L (CYFB, CXCA, CXBB)	All	All	All

Technical Background

Transmission control unit locked active/static, after transmission or mechatronics unit replacement.

Service

The mechatronics unit is part of the component protect list and will need to be adapted to the immobilizer. Under the special functions tab select 0025 Adapt Immobilizer. When asked to adapt keys select NO, adapting the keys is not needed. This will adapt the mechatronics to the component protection list.

Additional Information

Revision History

Revision Number	Released Date	Reason For Update
2052369/1	9/7/18	Original publication.

© 2018 Volkswagen Group of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.