

SS 1033870 Discontinuation of FCCC's Use Of Height Control Valve 16-16925-000/001


Service Solution Title <- SS 1033870 Discontinuation of FCCC's Use Of Height Control Valve
16-16925-000/001

Applicable Vehicles<- FCCC MC chassis built with a No suspension dump option

Symptoms<- Part number 16-16925-000 & -001 version has been discontinued in FCCC MC Chassis applications. A new valve has been designed to take its place. However, the new valve has a dump option that the original valve did not. The steps below instruct technicians on how to make the new replacement valve compatible for use in the FCCC MC chassis without dump suspension systems.

Issue<- The replacement valve(s) 16-213213-000/001 has an extra port on the side of the valve. On FCCC MC Chassis with non dump suspension systems do not have a dump control signal line to insert into this open port. If left open, the valve will leak air.

Solution<- Use plug part number 23-1445-001 and insert into the open control port on the new valve (see to Figure 1 reference #11). Then install the valve and the rest of the hoses as normal.

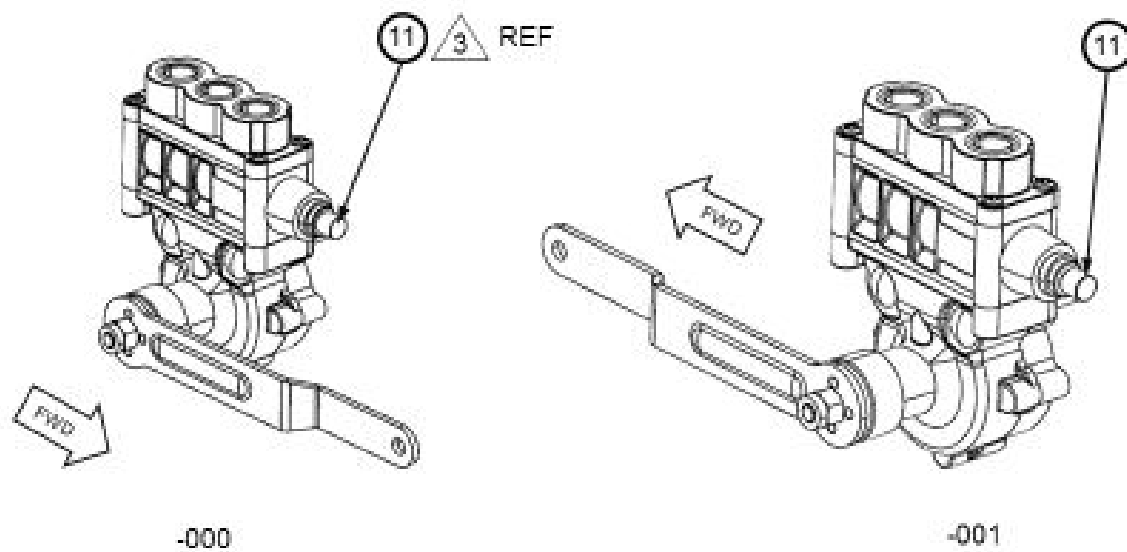

DETAIL: NO-DUMP VERSION OF VALVES
FROM DUMP VERSION
BY PLUGGING PORTS WITH PTC PLUG 23-14415-001

Figure 1