

GROUP	MODEL
ENG	2019MY
	Soul (PS) 1.6GDI
NUMBER	DATE
196	November 2018

TECHNICAL SERVICE BULLETIN

SERVICE ACTION: 1.6GDI ECU LOGIC

IMPROVEMENT FOR DTC P0128 (SA363)

This bulletin provides the procedure to improve the logic of the Engine Control Unit (ECU) on certain 2019MY Soul (PS) 1.6GDI vehicles, produced from April 2, 2018 through November 7, 2018, which may experience a malfunction indicator lamp (MIL) ON with DTC P0128. To correct this concern, apply the improved logic to the Engine system using the KDS ECU Upgrade function as described in this bulletin. For confirmation that the latest reflash has been applied to a vehicle you are working on, verify the ROM ID using the table on page 2 of this bulletin. Before conducting the procedure, verify that the vehicle is included in the list of affected VINs.

DTC P0128: Coolant Thermostat (Coolant Temperature below Thermostat Regulating Temperature)



Kia Diagnostic System (KDS)

* NOTICE

A Service Action is a repair program without customer notification that is performed during the warranty period. Any dealer requesting to perform this repair outside the warranty period will require DPSM approval.

Repair status for a VIN is provided on WebDCS (Service \rightarrow Warranty Coverage \rightarrow Warranty Coverage Inquiry \rightarrow Campaign Information). Not completed Recall / Service Action reports are available on WebDCS (Consumer Affairs \rightarrow Not Completed Recall \rightarrow Recall VIN \rightarrow Select Report), which includes a list of affected vehicles.

This issue number is **SA363**.

File Under: <Engine>

Circulate To: ☐ General Manager ☐ Service Manager ☐ Parts Manager

☑ Service Advisors ☑ Technicians ☑ Body Shop Manager ☐ Fleet Repair

SERVICE ACTION: 1.6GDI ECU LOGIC IMPROVEMENT FOR DTC P0128 (SA363)

ECU Upgrade Procedure:

To correct this condition, the ECU should be reprogrammed using the KDS download, as described in this bulletin.

Upgrade Event Name

395.PS PE GAMMA 1.6GDI ECU MIL ON DTC (P0128) LOGIC IMPROVEMENT

* NOTICE

- A fully charged battery is necessary before ECU upgrade can take place. It is recommended that the Midtronics GR8-1299 system be used in ECU mode during charging. DO NOT connect any other battery charger to the vehicle during ECU upgrade.
- All ECU upgrades must be done with the ignition key in the 'ON' position.
- Be careful not to disconnect the VCI-II connected to the vehicle during the ECU upgrade procedure.
- DO NOT start the engine during ECU upgrade.
- DO NOT turn the ignition key 'OFF' or interrupt the power supply during ECU upgrade.
- When the ECU upgrade is completed, turn the ignition 'OFF' and wait 10 seconds before starting the engine.
- ONLY use approved ECU upgrade software designated for the correct model, year.

* NOTICE

Before attempting an ECU upgrade on any Kia model, make sure to first determine whether the particular model is equipped with an immobilizer security system. Failure to follow proper procedures may cause the PCM to become inoperative after the upgrade and any claims associated with this repair may be subject to chargeback.

ROM ID INFORMATION TABLE:

Upgrade Event #395

Model	ЕМ	ТМ	System	ECU P/No.	ROM ID		
Model	iei Eivi Tivi Syste		System	ECU P/NO.	Previous	New	
	1.6 GDI	MT	Engine	39110-2BPF7	GPS-KNU06E000600	GPS-KNU06E100600	
		AT		39110-2BPG7	GPS-KNU06E000C02	GPS-KNU06E100C02	

To verify the vehicle is affected, be sure to check the Calibration Identification of the vehicle's ECM ROM ID and reference the Information Table as necessary.

SERVICE ACTION: 1.6GDI ECU LOGIC IMPROVEMENT FOR DTC P0128 (SA363)

* NOTICE

Prior to performing the ECU upgrade, be sure to check that the KDS is fully charged.

 Connect the VCI-II to the OBD-II connector, located under the driver's side of the instrument panel.


* NOTICE

The ECU upgrade function on KDS operates wirelessly. It is not necessary to perform the upgrade via USB cable.


2. With the ignition ON, turn ON the KDS tablet. Select **KDS** from the home screen.



 Confirm communication with VCI (A) and then configure the vehicle (B) using the AUTO VIN (C) feature.

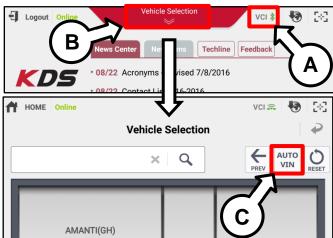

4. Select ECU Upgrade.

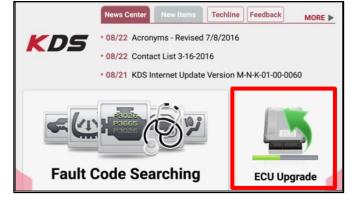



SERVICE ACTION: 1.6GDI ECU LOGIC IMPROVEMENT FOR DTC P0128 (SA363)

 The KDS will check the server for recently uploaded Events and then automatically download Upgrade Event #395.

* NOTICE

The vehicle must be identified in Vehicle Selection to download an Event for that vehicle.

6. Select Auto Mode.



Do NOT attempt to perform a Manual Mode upgrade <u>UNLESS</u> <u>Auto Mode fails</u>. Always follow the instructions given on the KDS in either Auto or Manual mode.

7. Select the **Engine** system under the System selection menu.


Touch **ID Check** (D) and confirm that the latest update is available.


Select **Upgrade Event #395** and select **Upgrade** to continue.


8. The ECU upgrade will begin and the progress of the upgrade will appear on the bar graph. Upgrade part (1/2) (E) will download the upgrade event to the VCI-II. Upgrade part (2/2) (F) will upgrade the ECU.




Do not touch the system buttons (like 'Back', 'Home', 'etc.') while performing ECU Upgrade.

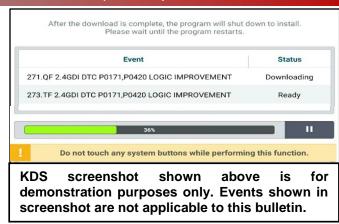

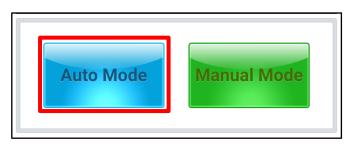

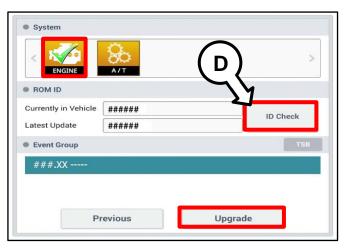

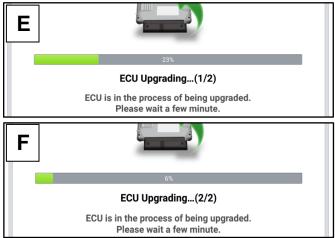

SERVICE ACTION: 1.6GDI ECU LOGIC IMPROVEMENT FOR DTC P0128 (SA363)


9. If a "Communication Fail" screen appears, verify that the VCI-II and KDS are communicating properly. Touch **OK** and restart the procedure from step 4.

* NOTICE


If an error notice continues to appear or if the upgrade cannot be performed, DO NOT disconnect the KDS/VCI-II. Contact GIT America Help Desk at (888) 542-4371 or Techline.

 When instructed on the KDS, turn the ignition OFF for ten (10) seconds then back on. Touch OK to continue.




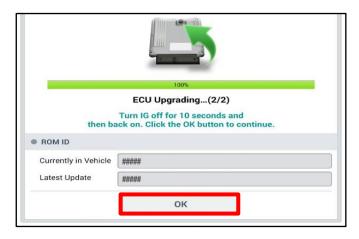

11. Once the upgrade is complete, touch **OK** to finalize the procedure.

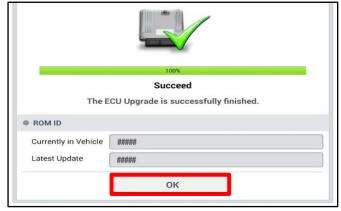

12. When prompted, select YES to check for Diagnostic Trouble Codes (DTC) and erase any DTCs stored such as EPS, ESC, and TPMS that may have been set during the upgrade.

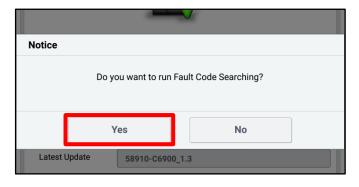

13. Start the engine to confirm proper operation of the vehicle.

SERVICE ACTION: 1.6GDI ECU LOGIC IMPROVEMENT FOR DTC P0128 (SA363)

Manual Upgrade Procedure:

* NOTICE

The manual upgrade should ONLY be performed if the automatic upgrade fails.

If the automatic upgrade fails, turn the ignition OFF for about 10 seconds then place it back in the ON position to reset the control unit BEFORE performing manual upgrade.

See table below for Manual Mode passwords.

Manual Mode ECU Upgrade Passwords

Menu	Password	
PS PE GAMMA 1.6GDI ULEV 6MT -IMMO : 39110-2BPF7	1027	
PS PE GAMMA 1.6GDI ULEV 6AT -IMMO : 39110-2BPG7	1028	

- 1. Within the ECU Upgrade screen displayed, select **Manual Mode**.
- 2. Select the **Engine** system under the System selection menu. Select **Upgrade Event** #395 and select **Upgrade** to continue.
- 3. Select the appropriate control unit part number with reference to the ROM ID Information Table on page 2, and select **OK**.
- 4. Enter the appropriate password from the Manual Mode password table above and select **OK**.
- 5. The upgrade will begin and the progress of the upgrade will appear on the bar graph.
- 6. When instructed on the KDS, turn the ignition **OFF** for ten (10) seconds then back on. Touch **OK** to continue.
- 7. Once the upgrade is complete, touch **OK** to finalize the procedure.
- 8. When prompted, select **YES** to check for Diagnostic Trouble Codes (DTC) and erase any DTCs stored such as EPS, ESC, and TPMS that may have been set during the upgrade.
- 9. Start the engine to confirm proper operation of the vehicle.

SERVICE ACTION: 1.6GDI ECU LOGIC IMPROVEMENT FOR DTC P0128 (SA363)

AFFECTED VEHICLE RANGE:

Model	Production Date Range		
Soul (PS)	April 2, 2018 through November 7, 2018		

WARRANTY INFORMATION:

N Code: N99 C Code: C99

Claim Type	Causal P/N	Qty.	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
V	39110 2BPF7	0	(SA363) 1.6GDI ECU Logic Improvement for DTC P0128	180141R0	0.3 M/H	N/A	0

* NOTICE

VIN inquiry data for this repair is provided for tracking purposes only. Kia retailers should reference <u>SA363</u> when accessing the WebDCS system.