Warnings without obvious cause from front parking sensors in vehicles with AMG Styling Package (SA code 772)

Topic number LI54.65-P-068316

Version 1

Function group 54.65 Parking assist

Date 06-27-2018

Validity Vehicles of BR 257 with AMG Styling Package (SA code

772)

Reason for change Reason for block

Complaint:

In vehicles with AMG Styling Package (SA code 772), warnings are issued without obvious cause (visual and acoustic) by the front parking sensors, mainly on the left-hand side.

Cause:

Possibly SCN coding in parking system control unit "N62" relating to sensor sensitivity.

The reasons stated below may lead to problems that must be noted:

- 1. Accessories license plate number frame mounted to front bumper.
- 2. Front license plate number incorrectly aligned.
- 3. Furthermore, removable accessories that are located in the range of the PARKTRONIC sensors.
- 4. Reduced vehicle driving height, which results in echoes from the ground.
- 5. Snow, slush, hailstones, sleet, heavy rain.
- 6. A gush of water that runs over the vehicle hood and down the parking sensors when braking.
- 7. Sensors badly soiled.
- 8. External ultrasonic sources such as air brake systems, compressed-air hammer, brake squeals from a vehicle in the immediate vicinity, etc.
- 9. In underground electric induction loops, at traffic lights or in parking garages.
- 10. Waste heat from overheated engines (exhaust) form in front of vehicle when it is at a standstill.

Remedy:

Perform SCN coding in parking system control unit "N62" (optimized sensor thresholds).

Note: Check the PARKTRONIC sensors thoroughly for malfunctions, cleanliness and correct orientation.

XENTRY TIPS

Symptoms

Communication/information / Assistance and warning systems / Parking assist / PARKTRONIC / Malfunction of displays / Operates without obvious cause

Communication/information / Assistance and warning systems / Parking assist / PARKTRONIC / Acoustic warning malfunction / Operates without obvious cause

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
02-9446	PERFORM SCN CODING IN CONTROL UNIT N62 WITH XENTRY	.5	8251B 90	