

Service Campaign Bulletin



Mercedes-Benz

Campaign No. 2018070001, July 2018

TO: ALL MERCEDES-BENZ CENTERS

SUBJECT: **C-Class (205) Model Year 2017 and 2018**
Check Windshield Wiper Transmission, Replace if Necessary

Daimler AG ("DAG"), the manufacturer of Mercedes-Benz vehicles, has determined that on certain MY17 and MY18 C-Class (205 platform) vehicles, the windshield wiper transmission may not meet production specifications. An authorized Mercedes-Benz dealer will check the windshield wiper transmission and replace it if necessary.

Prior to performing this Service Campaign:

- Please check VMI to determine if the vehicle is involved in the Campaign and if it has been previously repaired.
- Please review the entire Service Campaign bulletin and follow the repair procedure exactly as described.

Approximately 218 vehicles are affected.

Order No. P-SC-2018070001

This bulletin has been created and maintained in accordance with MBUSA-SLP S423QH001, Document and Data Control, and MBUSA-SLP S424HH001, Control of Quality Records.

Service Campaign Bulletin

Service Campaign Bulletin

Service Campaign Bulletin

Service Campaign Bulletin

Service Campaign Bulletin

Check Procedure

1. Remove cover over the brake unit in the engine compartment.
2. Remove attachment rivet (**A, figure 1**), slightly lift the water collector (**B, figure 1**) and read the manufacture date of the windshield wiper system (**C, figure 1**).
 - a. If production date is between May 31, 2017, to August 3, 2017: **Carry out work procedure.**
 - b. If production date is **NOT** between May 31, 2017, and August 3, 2017: **End measure.**

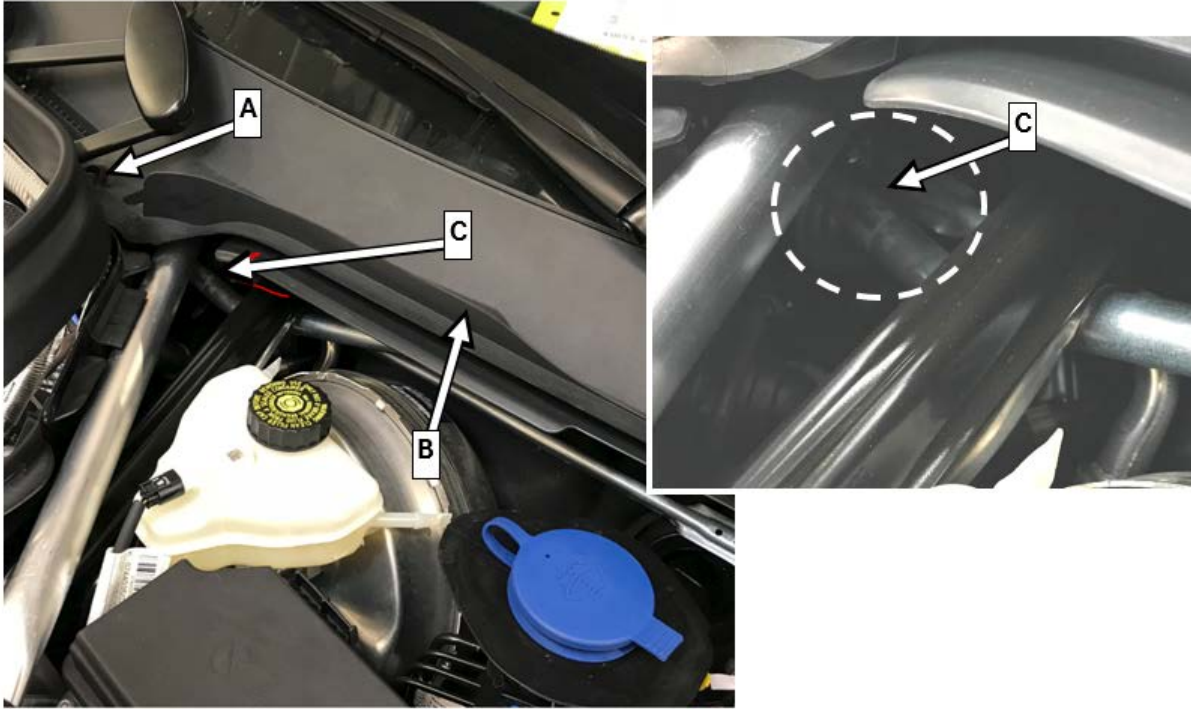


Figure 1



Figure 2

i The findings from the check procedure must be recorded in the workorder.

Work procedure

1. Replace windshield wiper system (**AR82.30-P-6400LW**).

Primary Parts Information

Qty.	Part Name	Part Number	Estimated Replacement Rate
As required	Wiper system	A 205 820 81 02	8%

i Small parts such as screws/bolts, self-locking nuts, sealing rings, cable ties, fluids, sealants, etc. are not listed in the parts list. The required small parts are taken into account in the budgeting.

i **Note:**

The following allowable labor operation should be used when submitting a warranty claim for this repair:

Warranty Information

Operation: Check windshield wiper system (02-2314)
Replace windshield wiper system (after check) (02-2315)

Damage Code	Operation Number	Labor Time (hrs.)
82 901 32 7	02-2314	0.1
	02-2315	0.9

i **Note**

Operation Number labor times are subject to change.