

Noises from seat climate control/ seat ventilation

Topic number	LI91.30-P-068713
Version	1
Function group	91.30 Seat heater, seat ventilation
Date	08-24-2018
Validity	BR166 and BR292 with 401 and without 555 (code: 401/-555)
Reason for change	
Reason for block	

Complaint:

Seat climate control/ seat ventilation makes noises when the seat is loaded (see video 1)

Attachments	
File	Description
MVI_0941.mp4	Video 1

Cause:

Fan rubbing on feed line under load (see picture 1)

Attachments	
File	Description
Draht_an_Belüftung.JPG	Picture 1

Remedy:

- Driver's seat:

-> Install mounts (A 166 919 48 00) on fan in cushion padding to prevent contact with the electrical feed line (see picture 2).

- Front passenger seat:

-> Without code U10: Install mounts (A 166 919 48 00) on fan in cushion padding to prevent contact with the electrical feed line (see picture 2).

-> With code U10: Replace entire driver seat cushion (separate parts may not be replaced due to the seat occupancy recognition system U10).

In the event of complaints after the cleanpoint 18.10.2017: Create a PTSS case and forward to Engineering

Symptoms
Body / Seat / Noises / Whirring

Parts						
Part number	ES1	ES2	Designation	Quantity	Note	EPC
A 166 919 48 00			Fan mounting	2	If code U10 is fitted, install on the driver's side only!	X

XENTRY TIPS

Attachments


File	Description
Aufnahme_Lüfter_EPC.JPG	Picture 2

Operation numbers/damage codes


Op. no.	Operation text	Time	Damage code	Note
			91C03 36	
			91R03 36	

Attachments

Draht_an_Belüftung.JPG:

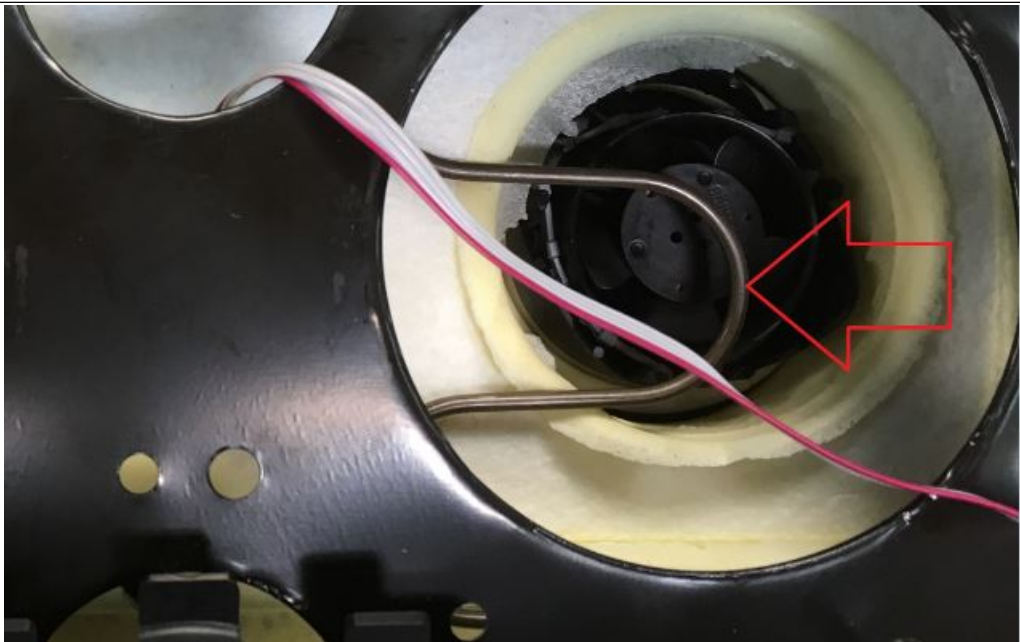

Aufnahme_Lüfter_EPC.
JPG:

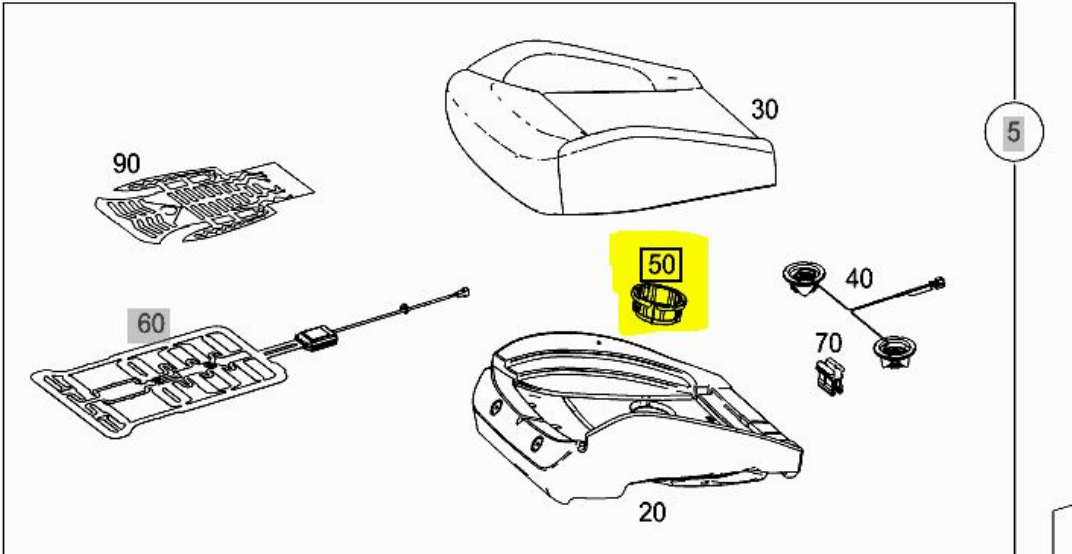

XENTRY TIPS
