

Trunk lid does not close

Topic number	LI88.50-P-068718
Version	1
Function group	88.50 Trunk lid
Date	08-27-2018
Validity	MODEL 222 with code 881/883/884 MODEL 217 MODEL 231
Reason for change	
Reason for block	

Complaint:

Trunk lid sporadically doesn't close or it opens again after being closed.

The trunk lock does not latch into the safety catch or main catch.

Cause:

When opening the trunk lid, the trunk lock does not return to its basic position.

The complaint is due to the trunks microswitch, the microswitch pin doesn't return to its starting position because of insufficient return force.

Remedy:

Do not replace any parts, replacement parts will not fix this issue.

Procedure until optimized parts are available:

Operating the outside trunk lid handle (S88/8) starts an initialization sequence in the trunk lock, so that the trunk lock returns to its basic position.

After this, the trunk lock function is temporarily available again.

Note: As soon as the optimized parts are available, this document will be updated.

Symptoms
Body / Door/Flap / Hood/flap / Trunk lid/liftgate / Jumps open
Body / Door/Flap / Hood/flap / Trunk lid/liftgate / Does not close completely
Body / Door/Flap / Hood/flap / Trunk lid/liftgate / Does not close