

Power Steering Light Illuminated for 20 Seconds After Vehicle Start

Service

Category Vehicle Interior

Section Meter/Gauge/Display Market USA



Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION
2015 - 2016	Camry	

Introduction

Some 2015 – 2016 model year Camry vehicles produced at the SIA plant may exhibit an illuminated power steering light that stays on for 15 – 20 seconds before turning off after the engine starts. Follow the Repair Procedure in this bulletin to address this condition.

Production Change Information

MODEL	PLANT	EFFECTIVE VIN
Camry	SIA	4T4********

Warranty Information

OP CODE	DESCRIPTION	TIME	OFP	T1	T2
EL1719	R & R Junction Block Cover	0.8	82672-06243	72	71

APPLICABLE WARRANTY

- This repair is covered under the Toyota Basic Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to occurrence of the specified condition described in this bulletin.

TOYOTA T-SB-0019-18 March 15, 2018 Page 2 of 11

Power Steering Light Illuminated for 20 Seconds After Vehicle Start

Parts Information

PART N	NUM BER	DADT NAME	
PREVIOUS	NEW	PART NAME	QTY
82672-06243	82672-06340	Fuse Cover Assembly	1

Required Tools & Equipment

SPECIAL SERVICE TOOLS (SST)	PART NUMBER	QTY
Lance Cancelling Tool M	<u>09991-00510</u>	1

NOTE

Additional SSTs may be ordered by calling 1-800-933-8335.

REQUIRED EQUIPMENT	SUPPLIER	PART NUMBER	QTY
Techstream 2.0*		TS2UNIT	
Techstream Lite	ADE	TSLITEPDLR01	1
Techstream Lite (Green Cable)		TSLP2DLR01	

^{*} Essential SST.

NOTE

- Only ONE of the Techstream units listed above is required.
- Software version 13.00.022 or later is required.
- Additional Techstream units may be ordered by calling Approved Dealer Equipment (ADE) at 1-800-368-6787.

TOYOTA T-SB-0019-18 March 15, 2018 Page 3 of 11

Power Steering Light Illuminated for 20 Seconds After Vehicle Start

Repair Procedure

- 1. Confirm the condition exists.
 - A. With the engine idling, turn ON the driver and passenger seat heater switches (ANY seat heater level position) and continue to idle for an additional 60 seconds.
 - B. Turn the I/G OFF and wait three seconds before restarting the engine.
 - C. Does the power steering light illuminate for 15 20 seconds before turning off AFTER the engine starts AND is there a delay in power steering assist?
 - YES Continue to substep D.
 - NO This bulletin does NOT apply. Continue diagnosis using the applicable Repair Manual.
 - D. With the engine idling, turn OFF the driver and passenger seat heater switches and continue to idle for an additional 60 seconds.
 - E. Turn the I/G OFF and wait three seconds before restarting the engine.
 - F. Does the power steering light turn OFF within the normal 2 3 seconds AND does the power steering assist operate immediately without a delay?
 - YES Continue to step 2.
 - NO This bulletin does NOT apply. Continue diagnosis using the applicable Repair Manual.
- 2. Disconnect the cable from negative (–) battery terminal.

CAUTION

Wait AT LEAST 90 seconds AFTER disconnecting the cable from the negative (-) battery terminal to disable the SRS system.

Refer to TIS, applicable model and model year Repair Manual:

2015 / 2016 Camry:
 General – Introduction – "Introduction: Repair Instruction: Precaution"


TOYOTA T-SB-0019-18 March 15, 2018 Page 4 of 11

Power Steering Light Illuminated for 20 Seconds After Vehicle Start

Repair Procedure (continued)


- 3. Remove the front door scuff plate LH.
 - A. Disengage the two claws (A) in the direction as shown.
 - B. Disengage the two claws (B) in the direction as shown.
 - C. Disengage the six claws (C) to remove the front door scuff plate LH.

Figure 1.

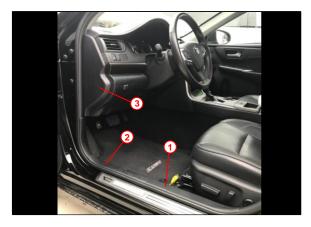

1	Front Door Scuff Plate LH
2	Cowl Side Sub-assembly LH
3	Instrument Side Panel LH

Figure 2.

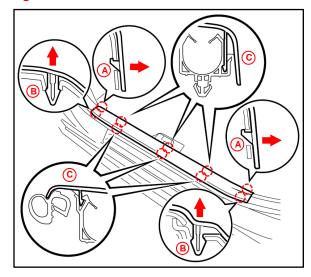


TOYOTA T-SB-0019-18 March 15, 2018 Page 5 of 11

Power Steering Light Illuminated for 20 Seconds After Vehicle Start

Repair Procedure (continued)


- 4. Remove the cowl side trim sub-assembly LH.
 - A. Remove the clip.
 - B. Disengage the two clips and remove the cowl side trim sub-assembly.

Figure 3.

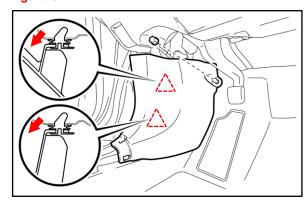


- 5. Remove the instrument side panel LH.
 - A. Disengage the four claws.

Figure 4.

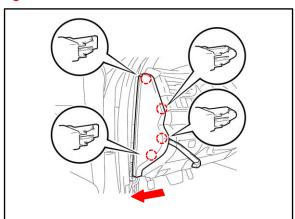

B. Disengage the three guides and remove the instrument side panel LH.

Figure 5.

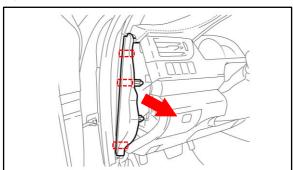


TOYOTA T-SB-0019-18 March 15, 2018 Page 6 of 11

Power Steering Light Illuminated for 20 Seconds After Vehicle Start

Repair Procedure (continued)

6. Disengage the claw and two guides to disconnect the hood lock control lever sub-assembly as shown.


Figure 6.

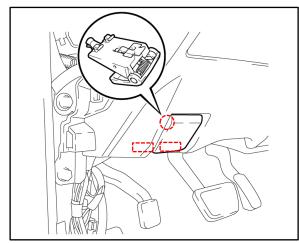

\bigcirc	Claw
$\Box\Box$	Guide

- 7. Remove the lower No.1 instrument panel finish panel assembly.
 - A. Remove the bolt and screw as shown.

Figure 7.

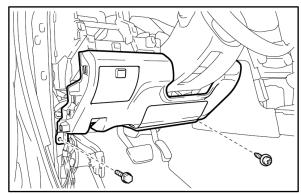

TOYOTA T-SB-0019-18 March 15, 2018 Page 7 of 11

Power Steering Light Illuminated for 20 Seconds After Vehicle Start


Repair Procedure (continued)

 B. Disengage the four claws, nine clips, and three guides to remove the lower No. 1 instrument panel finish panel assembly.

NOTE

The knee air bag does NOT need to be removed.


Figure 8.

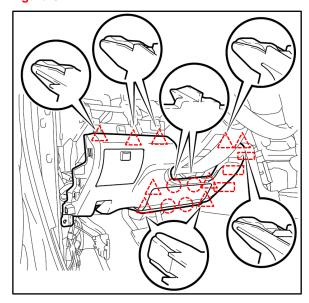

0	Claw
O	Guide
Δ	Clip

8. Remove the No.1 floor wire connector as shown.

Figure 9.

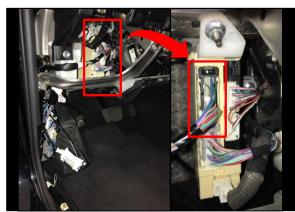


TOYOTA T-SB-0019-18 March 15, 2018 Page 8 of 11

Power Steering Light Illuminated for 20 Seconds After Vehicle Start

Repair Procedure (continued)


- 9. Disassemble the connector.
 - A. Remove the connector cover (black) as shown.

Figure 10.

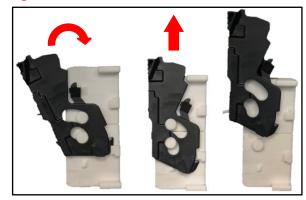

B. Separate the connector for ease of pin removal/insertion as shown.

Figure 11.

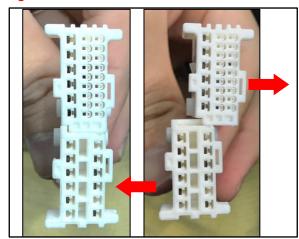

Power Steering Light Illuminated for 20 Seconds After Vehicle Start


Repair Procedure (continued)

10. Remove the red wire from Pin location 4 and place it into the empty cavity of Pin 14.

NOTE


- The red wire MUST be placed next to the violet wire in pin 13 (see Figure 13).
- Use the SST to remove the PIN.
 Refer to the video link below for PIN removal instructions:
 - 1.55 mm Terminal Removal

Figure 12.

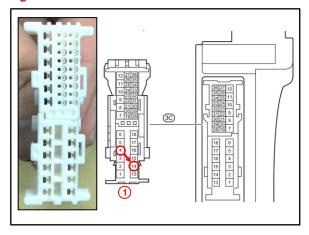

1 From Floor Wire

Figure 13.

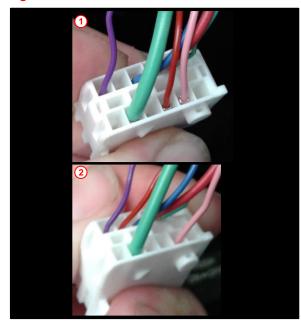

1	Before
2	After


TOYOTA T-SB-0019-18 March 15, 2018 Page 10 of 11

Power Steering Light Illuminated for 20 Seconds After Vehicle Start

Repair Procedure (continued)


- 11. Replace the fuse location.
 - A. Remove the original fuse cover assembly as shown and discard.

Figure 14.

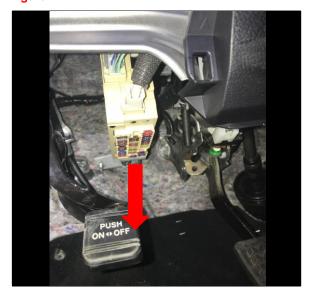

B. Remove the 10A fuse, "S/HTR&FAN F/L" from the current location and move it to the NEW location as shown.

Figure 15.

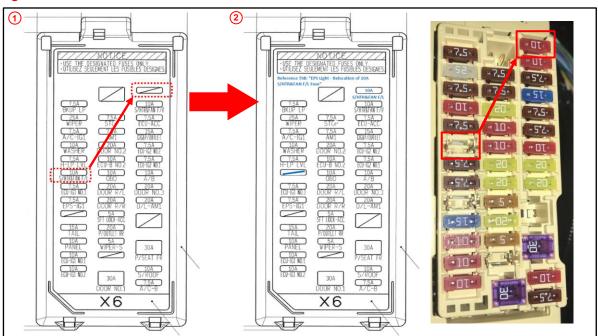

- 1 Original Fuse Cover
- 2 New Fuse Cover

TOYOTA T-SB-0019-18 March 15, 2018 Page 11 of 11

Power Steering Light Illuminated for 20 Seconds After Vehicle Start

Repair Procedure (continued)

- 12. Install the NEW fuse cover assembly.
- 13. Reassemble the connector and connect the No.1 floor wire connector.
- 14. Install the lower No.1 instrument panel finish panel assembly.
 - A. Engage the four claws, nine clips, and three guides.
 - B. Install the lower No.1 instrument panel finish panel with the bolt and screw.
- 15. Engage the claw and two guides to connect the hood lock control lever sub-assembly.
- 16. Install the instrument side panel LH.
 - A. Engage the three guides.
 - B. Engage the four claws to install the instrument side panel LH.
- 17. Install the cowl side trim sub-assembly LH.
 - A. Engage the two clips.
 - B. Install the cowl side trim sub-assembly LH with the clip.
- 18. Engage the 10 claws to install the front door scuff plate LH.
- 19. Reconnect the battery.

Torque: 5.4 N*m (55 kgf*cm, 48 in*lbf)

20. Initialize ALL affected systems.

Refer to TIS, applicable model and model year Repair Manual:

- 2015 / 2016 Camry: General – Introduction – "Introduction: Repair Instruction: Initialization"
- 21. Confirm the condition is no longer present.