# Technical Service Bulletin

Mazda North American Operations Irvine, CA 92618-2922



Subject: FLOCK FINISHING ON DOOR SASH MOLDING PEELS OFF WHEN OPENING FROZEN DOOR	Bulletin No.: 09-040/18
	Last Issued: 11/09/2018

#### **APPLICABLE MODEL(S)/VINS**

2017-2019 CX-5 2018-2019 CX-5 (Mexico spec.)

## DESCRIPTION

Some customers may notice the flock finishing on the door sash molding is peeled off (as shown below) when opening the frozen door. This concern may be caused by insufficient durability due to an improper production process of the door sash moldings. To eliminate this concern, the production process of the door sash moldings has been changed.



# **REPAIR PROCEDURE**

1. Verify the customer concern.

2. Replace the affected door sash molding(s) with modified part(s) according to the instructions on MGSS online:

Page 1 of 4

- FRONT SASH MOLDING REMOVAL
- FRONT SASH MOLDING INSTALLATION
- REAR SASH MOLDING REMOVAL
- REAR SASH MOLDING INSTALLATION

3. Verify the repair.

## PARTS INFORMATION

## FRONT SASH MOLDING (RIGHT):

Part Number	Description		Remark
KB7W-50-981K	MOULD (R), FRONT, SASH'A'		
KB7W-50-640C	MOULD (R), FRONT, BELT	1	[R]
KB7W-50-M10B	GARNISH (R), FRONT DOOR	1	[R] B-PILLARGARNISH BLACK
KB8A-50-M10D	GARNISH (R), FRONT DOOR	1	[R] B-PILLARGARNISH PIANO BLACK

## FRONT SASH MOLDING (LEFT):

Part Number	Description		Remark
KB7W-50-985K	MOULD (L), FRONT, SASH'A'	1	
KB7W-50-650C	MOULD (L), FRONT, BELT	1	[R]
KB7W-50-M20B GARNISH (L), FRONT DOOR		1	[R] B-PILLAR GARNISH
	GARNISH (L); FRONT DOOR	1	BLACK
	B8A-50-M20D GARNISH (L), FRONT DOOR		[R] B-PILLAR GARNISH
KDOA-JU-IVIZUD	GARNISH (L), FRONT DOOR	1	PIANO BLACK

## **REAR SASH MOLDING (RIGHT):**

Page 2 of 4

Part Number	Description		Remark
KB7W-50-991K	MOULD (R), REAR, SASH'A'	1	
KB7W-50-660C	MOULD (R), REAR, BELT	1	[R]
KB7W-50-M30B	GARNISH (R), REAR DOOR	1	[R] B-PILLAR GARNISH BLACK
KB8A-50-M30C	GARNISH (R), REAR DOOR	1	[R] B-PILLAR GARNISH PIANO BLACK
KB7W-50-M50A	GARNISH (R), REAR DOOR	1	[R] C-PILLAR GARNISH BLACK
KB8A-50-M50C	GARNISH (R), REAR DOOR	1	[R] C-PILLAR GARNISH PIANO BLACK

## **REAR SASH MOLDING (LEFT):**

Part Number	Description	Qty.	Remark
KB7W-50-995K	MOULD (L), REAR, SASH'A'	1	
KB7W-50-670C	MOULD (L), REAR, BELT	1	[R]
KB7W-50-M40B	GARNISH (L), REAR DOOR	1	[R] B-PILLAR GARNISH BLACK
KB8A-50-M40C	GARNISH (L), REAR DOOR	1	[R] B-PILLAR GARNISH PIANO BLACK
KB7W-50-M60A	GARNISH (L), REAR DOOR	1	[R] C-PILLAR GARNISH BLACK
KB8A-50-M60C	GARNISH (L), REAR DOOR	1	[R] C-PILLAR GARNISH PIANO BLACK

## WARRANTY INFORMATION

Symptom Code	92	
Damage Code	92	
	****-50-981*	
	or	
	****-50-985 *	
Part Number Main Cause	or	
	****-50-991*	
	or	
	****-50-995*	

#### Page 3 of 4

Bulletin No.: 09-040/18	Last Issued: 11/09/2018

	(Select the part number of the affected sash molding applicable to the subject vehicle from "Parts Information" table.)
Quantity	1
Operation No. and Labor Hours	Refer to the table below

NOTE: Claim other necessary parts for repair, Qty. = 1 as related part.

#### Sash Moldings Replaced: ONE

<b>Operation No.</b>	Labor Hrs.	Replacement
XXP9NARX	0.5	One (1) front sash molding
XXP9NBRX	0.6	One (1) rear sash molding

#### Sash Moldings Replaced: TWO

<b>Operation No.</b>	Labor Hrs.	Replacement
XXP9NCRX	0.8	Both front sash moldings
XXP9NDRX	1.0	Both rear sash moldings
XXP9NERX	0.9	One (1) front and one (1) rear sash molding

## Sash Moldings Replaced: THREE

<b>Operation No.</b>	Labor Hrs.	Replacement
XXP9NFRX	1.1	Both front sash moldings and one (1) rear sash molding
XXP9NGRX	1.3	One (1) front sash molding and both rear sash moldings

#### Sash Moldings Replaced: FOUR

<b>Operation No.</b>	Labor Hrs.	Replacement
XXP9NHRX	1.5	All sash moldings

#### Page 4 of 4