

Service

Category Vehicle Interior

Section Seat Market USA



Applicability

YEAR(S) MODEL(S)		ADDITIONAL INFORMATION		
2016 - 2019	RX350, RX450H			

REVISION NOTICE

November 28, 2018 Rev1:

• The Warranty Information section has been updated.

Any previous printed versions of this bulletin should be discarded.

Introduction

Some 2016 – 2019 model year RX350 and RX450h vehicles may exhibit a condition where there is a noticeable seat heater temperature difference between the driver and/or passenger seats. Follow the Repair Procedure in this bulletin to address this condition.

Production Change Information

This bulletin applies to vehicles produced **BEFORE** the Production Change Effective VINs shown below.

MODEL	DRIVETRAIN	PLANT	PRODUCTION CHANGE EFFECTIVE VIN
RX350			JTJBZMCA#J2034755
RX450h	AWD	TMAZ	JTJDGKCA#J2004793
RX350L		TMK	JTJDZKCA#J2013607
	2WD		JTJGZKCA#J2008741
RX450h	AWD		2T2BGMCA#JC026105
RX350		TMMC	2T2BZMCA#JC159252
	2WD		2T2ZZMCA#JC110080



Warranty Information

OP CODE	DESCRIPTION	TIME	OFP	T1	T2
BD1819	R & R Front Cushion Seat Heater Assy (One Side)	2.0	87510-0E320		71
Combo A	Opposite Side	1.6	87510-48200 87510-48190	87	71

APPLICABLE WARRANTY

- This repair is covered under the Lexus Basic Warranty. This warranty is in effect for 48 months or 50,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to occurrence of the specified condition described in this bulletin.

Parts Information

PART NUMBER		PART NAME	PRODUCTION	QTY
PREVIOUS	NEW	PARI IVAIVIE	PRODUCTION	QII
87510-0E280	87510-0E281	Heater Assy, Front Seat Cushion, LH	NAP	1
87510-0E320	87510-0E321	Heater Assy, Front Seat Cushion, RH	INAF	1
87510-48200	87510-48201	Heater Assy, Front Seat Cushion, LH	CBU	1
87510-48190	87510-48191	Heater Assy, Front Seat Cushion, RH	CBU	1

Required Tools & Equipment

REQUIRED EQUIPMENT	SUPPLIER	PART NUMBER	QTY	
Techstream 2.0*		TS2UNIT		
Techstream Lite	ADE	TSLITEPDLR01	1	
Techstream Lite (Green Cable)		TSLP2DLR01		

^{*} Essential SST.

NOTE

- Only ONE of the Techstream units listed above is required.
- Software version 13.20.018 or later is required.
- Additional Techstream units may be ordered by calling Approved Dealer Equipment (ADE) at 1-800-368-6787.

Repair Procedure

1. Confirm the condition exists.

When the seat heater is turned on, is there a noticeable temperature difference between the driver and/or passenger seats regardless of the setting that reaches up to 120°F?

• YES — Continue to step 2.

L-SB-0038-18

- NO This bulletin does NOT apply. Continue diagnosis using the applicable Repair Manual.
- 2. Using Techstream, check the A/C ECU Data List.


Refer to TIS, applicable model and model year Repair Manual:

- 2016 2019 RX350:
 Vehicle Interior Seat "Seat: Seat Heater System: Data List / Active Test"
- 2016 2019 RX450h:
 Vehicle Interior Seat "Seat: Seat Heater System: Data List / Active Test"
- Check FR and FL seat heater temperatures.

When the seat heater is turned on, does the signal increase sharply and reach up to 120°F?

- YES This bulletin does NOT apply. Continue diagnosis using the applicable Repair Manual.
- NO Continue to step 4.

Figure 1.

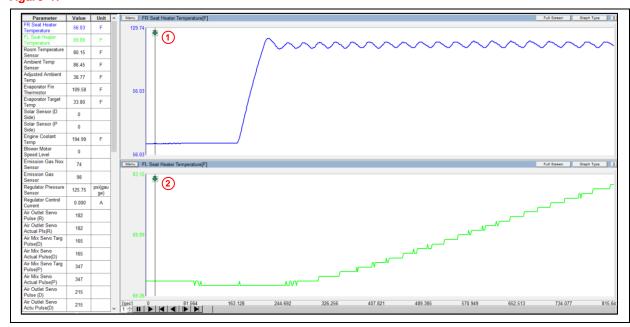

1 Correct Seat Heater Operation (Sharp Increase to 120°F)
2 Incorrect Seat Heater Operation



Repair Procedure (continued)

4. Replace the seat heater element that is functioning incorrectly according to the results of step 3.

Refer to TIS, applicable model and model year Repair Manual:

- 2016 RX350:
 - Vehicle Interior Seat "Seat: Front Seat Cushion Heater: Removal / Installation"

Page 4 of 4

- 2017– 2019 RX350:
 - Vehicle Interior Seat "Seat: Front Seat Cushion Heater: Removal / Installation"
- 2016 RX450h:
 - Vehicle Interior Seat "Seat: Front Seat Cushion Heater: Removal / Installation"
- 2017 2019 RX450h:
 - Vehicle Interior Seat "Seat: Front Seat Cushion Heater: Removal / Installation"
- 5. Confirm normal seat heater operation.