



DATE: 11-02-18

APPLIES TO: This technical service bulletin applies to certain model year 2017 through 2019, K2 model motorhome chassis built between November 8, 2016 and December 3, 2018.

CONDITION: Shocks may allow for a ride that is considered to be too soft.

CORRECTION: Replace shocks

LABOR ALLOCATION: 1.5 Hours

CLASSIFICATION: T3

PARTS NEEDED:

	<u>QTY</u>	<u>Part Number</u>	<u>Description</u>
Kit # S-2673-001 Contains:	1	S-2673-001	KIT – SERVICE, FRONT SHOCK

	<u>QTY</u>	<u>Part Number</u>	<u>Description</u>
	2	0562-SS5-001	SHOCK - 46MM IFS 20K
	1	TSB18-250-003	INSTRUCTION DOCUMENTATION
	1	TSB18-250-004	INSTRUCTION DOCUMENTATION

GENERAL INSTRUCTIONS:

Thoroughly review entire service bulletin before starting work. If there are questions or concerns with steps defined in this service bulletin, contact Spartan Motors USA, Inc. Customer & Product Support Group.

All applicable industry safety standards must be followed when performing work identified in this procedure.

STEP-BY-STEP INSTRUCTIONS:

1. Ensure Parking brake is set and vehicle has wheel chocks properly installed.

Service Bulletins are intended for use by Professional Technicians only. They are written to guide Professional Technicians in performing service to vehicles of specific nature in conjunction with industry standards. Professional Technicians should be appropriately trained on industry standards and have the tools and equipment to perform procedures safely and properly.



2. Remove lower thru bolt from shock eye mount and retain for reuse. Refer to FIG. 2-1.
3. Remove upper thru bolt from shock eye mount and retain for reuse. Refer to FIG. 2-1.



FIG. 2-1

4. Remove shock from vehicle and properly dispose of.

Service Bulletins are intended for use by Professional Technicians only. They are written to guide Professional Technicians in performing service to vehicles of specific nature in conjunction with industry standards. Professional Technicians should be appropriately trained on industry standards and have the tools and equipment to perform procedures safely and properly.



5. Repeat steps 1-4 on opposite side.
6. Install shock such that lower thru bolt can be installed through shock mounting eye. Refer to FIG. 3-1.
7. Reinstall retained lower thru bolt. Refer to FIG. 3-1.

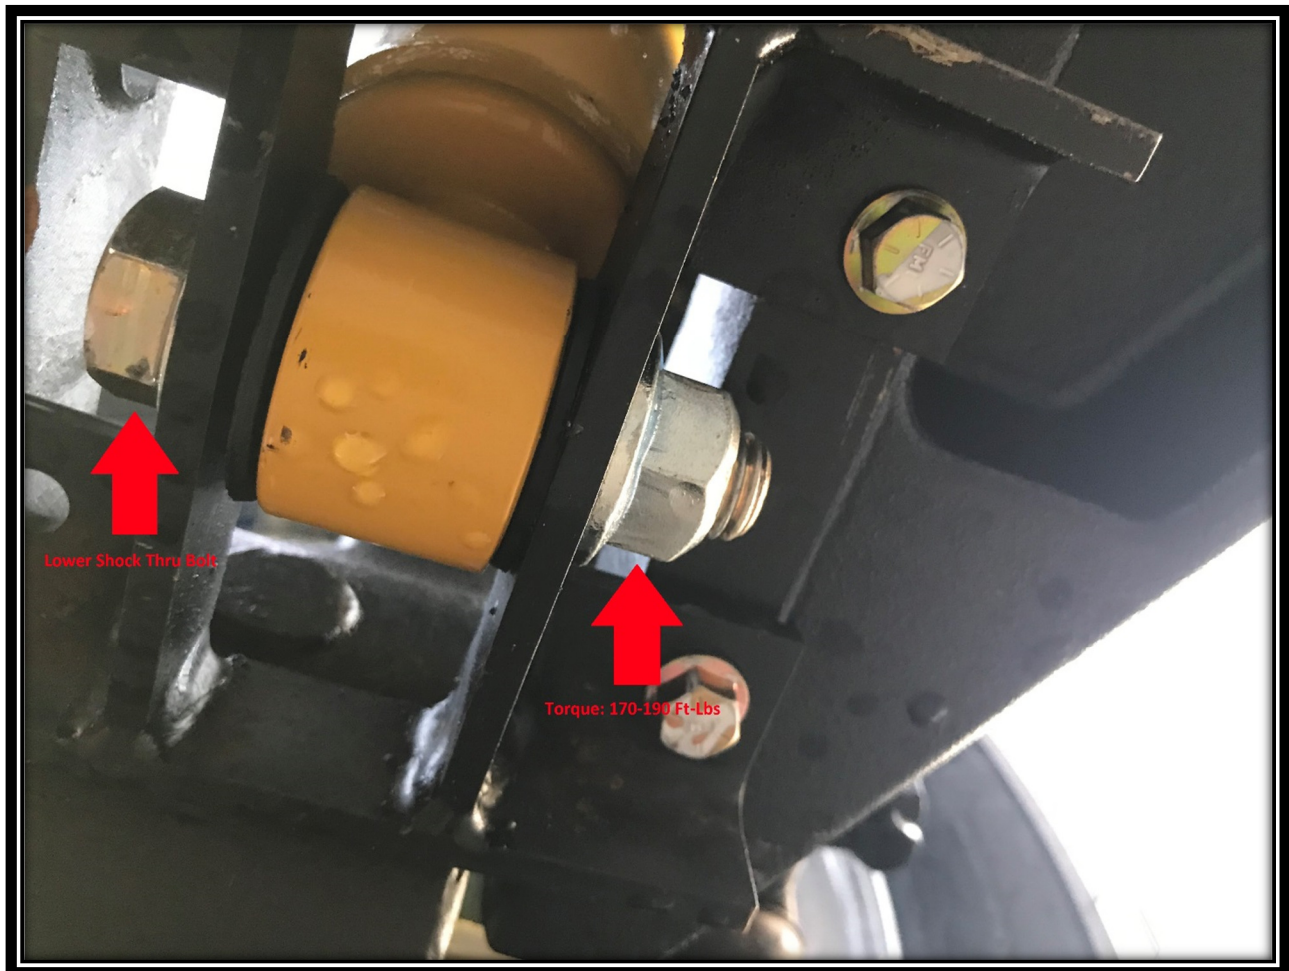


FIG. 3-1

8. Reinstall retained upper thru bolt. Refer to FIG. 4-1.

Service Bulletins are intended for use by Professional Technicians only. They are written to guide Professional Technicians in performing service to vehicles of specific nature in conjunction with industry standards. Professional Technicians should be appropriately trained on industry standards and have the tools and equipment to perform procedures safely and properly.



FIG. 4-1

9. Torque lock nuts to 170-190 lbf-ft.

Service Bulletins are intended for use by Professional Technicians only. They are written to guide Professional Technicians in performing service to vehicles of specific nature in conjunction with industry standards. Professional Technicians should be appropriately trained on industry standards and have the tools and equipment to perform procedures safely and properly.