

Technical Service Bulletin

GROUP	NUMBER
CAMPAIGN	18-01-042
DATE	MODEL(S)
DECEMBER, 2018	ELANTRA
	(AD)

SUBJECT

PASSENGER SIDE OUTSIDE MIRROR NOISE REPAIR (SERVICE CAMPAIGN T3N)

* IMPORTANT

*****DEALER STOCK ONLY*****

Dealers must perform this Service Campaign on all affected vehicles prior to customer retail delivery.

When a vehicle arrives at the Service Department, access Hyundai Motor America's "Warranty Vehicle Information" screen via WEBDCS to identify open Campaigns.

Description: On certain Elantra (AD) vehicles, the passenger side outside mirror may exhibit a whistle noise while driving. This bulletin provides the procedure to repair the outside mirror noise on the passenger side.

Applicable Vehicles: Certain 2019MY Korean Built Elantra (AD)

Parts Information:

Part Name	Image	Part Number	Quantity
NOISE PREVENTION PAD KIT		00876-F2000	5 PADS/KIT


Warranty Information:

MODEL	OP CODE	OPERATION	OP TIME	CAUSAL PART	NATURE	CAUSE
ELANTRA (AD)	80C082R1	PASSENGER SIDE OUTSIDE MIRROR NOISE REPAIR	0.2	00876-F2000	Q12	ZZ8

NOTE: Submit Claim on Campaign Claim Entry Screen

Service Procedure:

1. Check the standard line (A) of the outside mirror base cover on the passenger side (normal mirror design position).

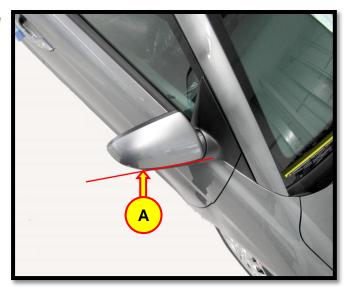

2. Pull the outside mirror (B) to the front side and bend approximately 45 degrees.



A CAUTION

Pull the mirror (B) horizontally not vertically.




TSB #: 18-01-042 Page 2 of 5


3. Check the position of the base cover standard line (A) and pad attachment (C). Orient the mirror accordingly so the base molding gap can be seen for the application of the tape.

NOTICE


Wipe the base molding with a clean alcohol wipe to decontaminate the application surface.

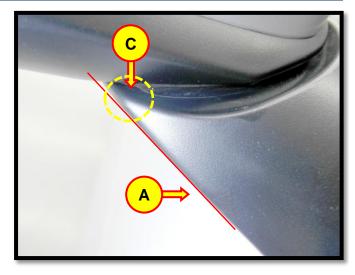

Check the position of the tape starting (C).
Maintain the 3mm distance from the end line (D) when attaching the pad.

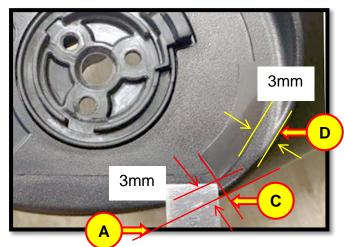

5. Remove the pad (F) from the vinyl backing (G).

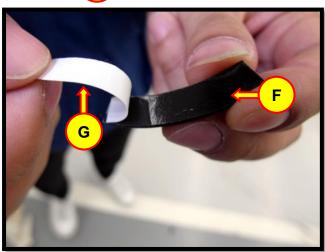



TSB #: 18-01-042 Page 3 of 5


6. Carefully insert and position the pad (F) between the mirror and base cover (I) with the adhesion surface (H) downward. (Refer to step 7 of this procedure for correct positioning of pad).

NOTICE

It may be helpful to use tweezers or toothpicks to insert and position the noise reducing pad.

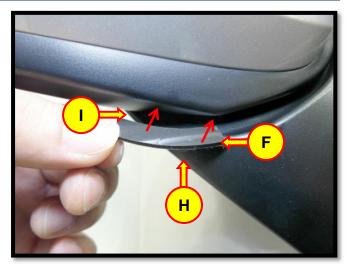

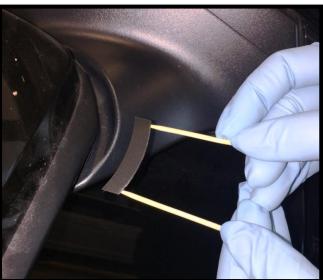

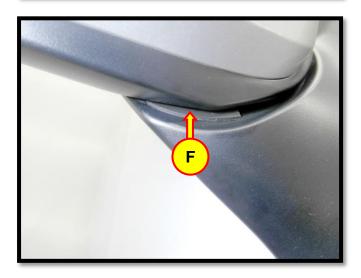

TSB #: 18-01-042 Page 4 of 5

A CAUTION


If the installation of the pad is done incorrectly and a new pad has to be installed, be certain to remove all remnants of adhesive before the installation of another new pad.



7. Reposition mirror (B) back to the normal position.

CAUTION

Ensure tape is not seen when mirror is in normal position. If tape is seen, remove the tape and install a replacement tape.

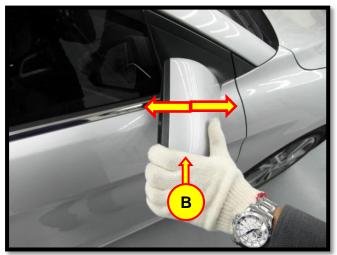

8. Service procedure in now complete.

TSB #: 18-01-042 Page 5 of 5