

SUBJECT:			No:	TSB-18-37-001
TORQUE UPDATES: UNITS OF TIGHTENING TORQUE & NUMERICAL VALUE			DATE:	December 2018
FOR POWER STEERING - SERVICE MANUAL REVISION MODEL: See below				
CIRCULATE TO:	[] GENERAL MANAGER	[X] PARTS MANAGER		[ <b>X</b> ] TECHNICIAN
[X] SERVICE ADVISOR	[X] SERVICE MANAGER	[X] WARRANTY PROCESSO	DR	[] SALES MANAGER

## PURPOSE

This TSB updates the Power Steering section of the affected Service Manuals to correct the tightening torque for the Power Steering Gear Box, Power Steering Control Unit (EPS-ECU), Steering Shaft, Power Steering Oil Pump Assembly and Power Steering Hoses.

# AFFECTED VEHICLES

- 2008, 2011 2017 Lancer
- 2011 2017 Lancer Sportback
- 2008 & 2014 Lancer Evolution

# AFFECTED SERVICE MANUAL

- 2008 Lancer Service Manual, Group 37 Power Steering
- 2011-2017 Lancer/Lancer Sportback Service Manual, Group 37 Power Steering
- 2008 & 2014 Lancer Evolution Service Manual, Group 37 Power Steering

Copyright 2018, Mitsubishi Motors North America, Inc.

Continued

Please make the indicated changes to the 2008 Lancer Service Manual, Group 37 - Power Steering -> Power Steering Gear Box and Linkage.


## **REMOVAL AND INSTALLATION**

#### A WARNING

Before removing the steering gear, refer to GROUP 52B, Service Precautions and Air Bag Module and Clock Spring. Center the front wheels. Failure to do so may damage the SRS clock spring and render the SRS system inoperative, risking serious injury.

## A CAUTION

The bolts and nuts marked with <sup>\*</sup> are coated with the friction coefficient stabilizer. When removing these parts, make sure that they are free of damage, remove any dust and dirt on the bearing surfaces and the threads, and tighten to the specified torque.

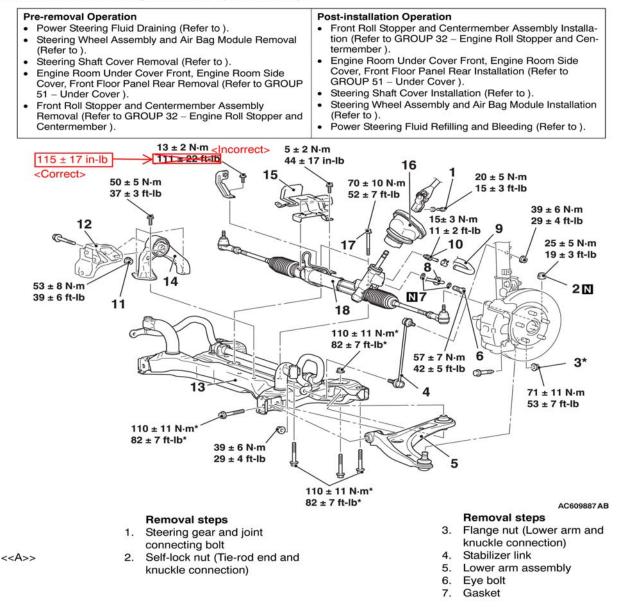


Please make the indicated changes to the 2011 - 2015 Lancer/Lancer Sportback Service Manual, Group 37 - Power Steering -> Electric Power Steering (EPS) -> Electric Power Steering Control Unit (EPS-ECU).

# **REMOVAL AND INSTALLATION**

## A CAUTION

The electric power steering-ECU should be replaced together with the gear housing.

- Pre-removal and Post-installation Operation
- Bottom Cover Removal and Installation (Refer to GROUP 52A Glove Box).
- Cowl Side Trim Removal and Installation (Refer to GROUP 52A – Trim).

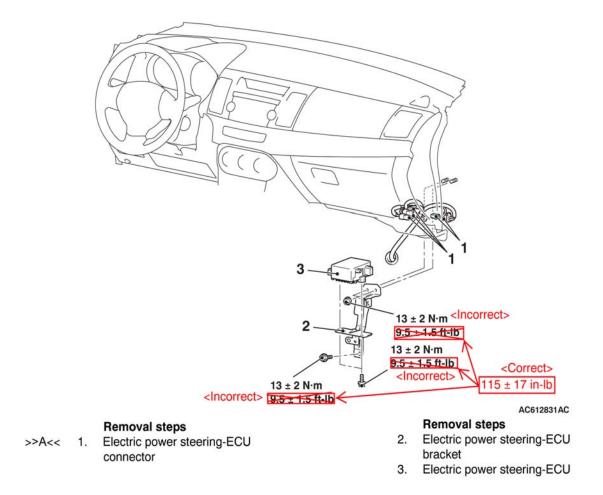

# INSTALLATION SERVICE POINT


>>A<< ELECTRIC POWER STEERING CONNECTOR

Please make the indicated changes to the 2008 Lancer Evolution Service Manual, Group 37 - Power Steering -> Steering Shaft -> Removal and Installation.

### **REMOVAL AND INSTALLATION**

#### A CAUTION

- Before removing the steering wheel assembly and driver's air bag module/knee air bag module, always refer to GROUP 52B – Service Precautions and Air bag Module and Clock Spring or Knee Air bag Module .)
- After installation, perform a calibration for the ASC-ECU to learn the steering wheel sensor neutral point. (Refer to GROUP 35C On-vehicle Service, Steering Wheel Sensor Calibration .)

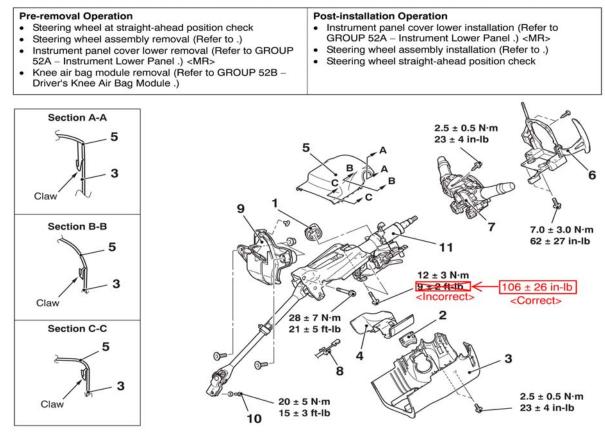

Note: claw position is symmetrical

<<A>>


#### Removal steps

- Knob cap <Vehicles with KOS>
- 2. Ignition key cover
- 3. Steering column lower cover
- 4. Steering column protector

#### AC709222 AB

#### **Removal steps**

- Receiver antenna module removal (Refer to GROUP 42B – Exterior Transmitter Antenna Assembly, Interior Transmitter Antenna Assembly, Receiver Antenna Module .) <Vehicles with KOS>
- WCM removal (Refer to GROUP 42C – WCM .) <Vehicles with WCM>
- 5. Steering column upper cover

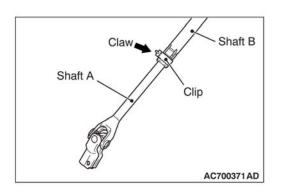

# <<C>> STEERING COLUMN SHAFT ASSEMBLY DISCONNECTION

 
Disconnect the steering gear from the steering column shaft assembly while sliding shaft A to shaft B with the clip claw as shown in the figure being pinched.


# INSTALLATION SERVICE POINT

>>A<< Steering column shaft assembly installation  ${\ensuremath{\tiny [la]}}$ 

- 1. Ensure that the tilt lever is in the lock position.
- 2. Temporarily tighten the mounting bolts in the order of a, b, and c, and then tighten them in the order of c, b, and a to the specified torque.


# Tightening torque a: $28 \pm 7$ N·m ( $21 \pm 5$ ft-lb) Tightening torque b,c: $12 \pm 3$ N·m $9 \pm 2$ ft-lb) < Incorrect>



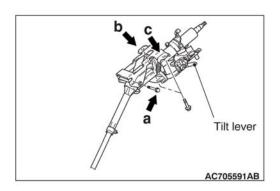

Please make the indicated changes to the 2008 Lancer Evolution Service Manual, Group 37 -Power Steering -> Power Steering Oil Pump Assembly -> Removal and Installation.

# REMOVAL AND INSTALLATION

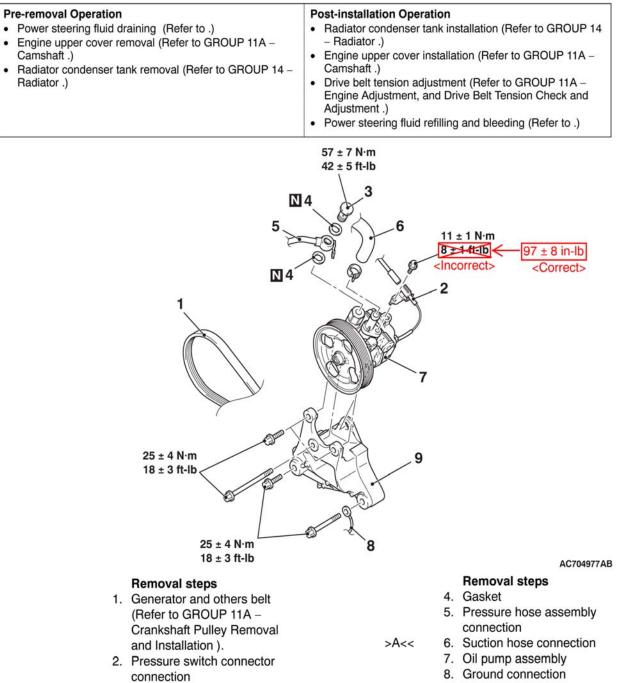


3. Eye bolt

- 9. Oil pump bracket

Please make the indicated changes to the 2008 Lancer Evolution Service Manual, Group 37 - Power Steering -> Power Steering Hoses -> Removal and Installation.

## **REMOVAL AND INSTALLATION**

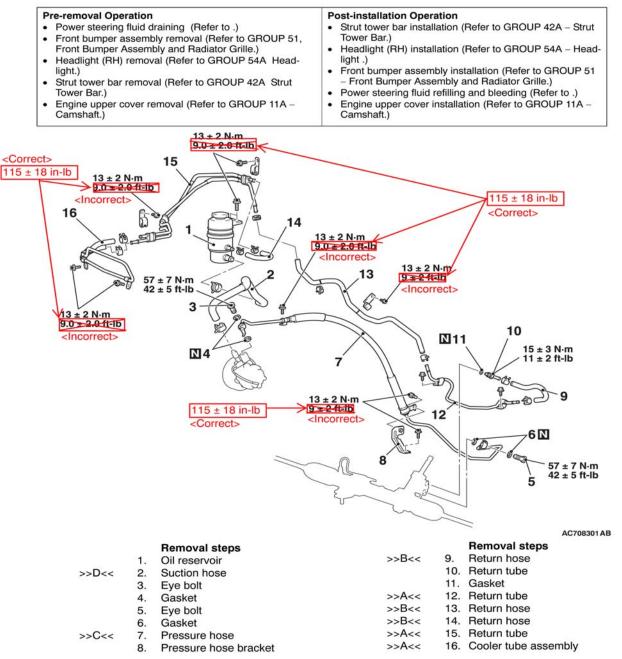

## INSTALLATION SERVICE POINTS 0

>>A<< COOLER TUBE ASSEMBLY/RETURN TUBE ASSEMBLY

Please make the indicated changes to the 2014 Lancer Evolution Service Manual, Group 37 - Power Steering -> Power Steering Hoses -> Removal and Installation.

## **REMOVAL AND INSTALLATION**

