



Technical Service Bulletin

91 Top view camera setting changes to graphic view intermittently after startup

91 18 19 2053028/1 November 28, 2018.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A4, A5, Q5, and Q7	2018	All	With front and rear view camera system and two side cameras

Condition

Customer states:

- When the reversing camera is active showing the Top view camera to the right, the display changes intermittently at startup from camera view to graphic view. Compare the images to the right (Figure 1 and 2).



Figure 1. Correct camera view.



Figure 2. Incorrect graphic view.

Technical Background

The software needs to be updated. The optimized software will correct the view switch.

Production Solution

New software in the information electronics control module 1, J794 (address word 005F) addressed the condition.



Technical Service Bulletin

Service

SVM Update Instructions

1. Follow all instructions in TSB 2011732: *00 Software Version Management (SVM), operating instructions* and TSB 2047812: *00 SD Creator: How to setup and use the SD Creator for obtaining vehicle software updates via the MirrorServer*.
2. Update the information electronics control module 1, J794 (address word 005F) using the SVM action code as listed in the table below, if necessary:

Model	Old Software Part Number	Software Version	SVM Code Input
A4/A5/Q5/Q7	4M0.035.880 4M0.035.890 8W0.035.880 8W0.035.890	0443	MH12QUS5087
A4/A5/Q5/Q7	4M0.035.880 4M0.035.890 8W0.035.880 8W0.035.890	0888	
A4/A5/Q5/Q7	4M0.035.880.B 4M0.035.890.B 8W0.035.880.A 8W0.035.890.A	0692	
A4/A5/Q5/Q7	4M1.035.880 4M1.035.890 8W5.035.880 8W5.035.890	0918	
A4/A5/Q5/Q7	4M1.035.880.A 4M1.035.890.A 8W5.035.880.A 8W5.035.890.A	1118	
A4/A5/Q5/Q7	4M1.035.880.B 4M1.035.890.B 8W5.035.880.B	1178	



Technical Service Bulletin

	8W5.035.890.B		
A4/A5/Q5/Q7	4M1.035.880.D 4M1.035.890.D 8W5.035.880.D 8W5.035.890.D	1320	
A4/A5/Q5/Q7	4M1.035.880.C 4M1.035.890.C 8W5.035.880.C 8W5.035.890.C	1316	
Q7	4M0.035.844 4M0.035.878	0603	
Q7	4M0.035.844.A 4M0.035.878.A 8V1.035.844 8V1.035.878	0740	
Q7	4M0.035.844.C 4M0.035.878.C 8V1.035.844.B 8V1.035.878.B	0840	
Q7	4M0.035.844.D 4M0.035.878.D 8V1.035.844.D 8V1.035.878.D	0958	
Q7	4M0.035.844.D 4M0.035.878.D 8V1.035.844.D 8V1.035.878.D	0959	
A4/A5/Q5	8W0.035.652.A 8W0.035.654.A 8V1.035.652	0110	



Technical Service Bulletin

A4/A5/Q5	8W0.035.652.E 8W0.035.654.E 8V1.035.652.B 8V1.035.654.B	0126	
A4/A5/Q5	8W0.035.652.C 8W0.035.654.C 8V1.035.652.F 8V1.035.654.F	0144	
A4/A5/Q5	8W0.035.652.C 8W0.035.654.C 8V1.035.652.A 8V1.035.654.A	0158	
A4/A5/Q5	8W0.035.652.C 8W0.035.654.C 8V1.035.652.A 8V1.035.654.A	0150	
A4/A5/Q5	8W0.035.652.C 8W0.035.654.C 8V1.035.652.A 8V1.035.654.A	0158	
A4/A5/Q5	8W0.035.652.C 8W0.035.654.C 8V1.035.652.A 8V1.035.654.A	0160	
A4/A5/Q5	8W0.035.652.K 8W0.035.654.K 8V1.035.652.F 8V1.035.654.F	0179	
A4/A5/Q5	8W0.035.652.J 8W0.035.654.J 8V1.035.652.D	0185	



Technical Service Bulletin

	8V1.035.654.D		
--	---------------	--	--

Warranty

Claim Type:	<ul style="list-style-type: none">• 110 up to 48 Months/50,000 Miles.• G10 for CPO Covered Vehicles – Verify Owner.• If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	9196		
Damage Code:	0039		
Labor Operations:	Software Update	0151 0000	Time stated on diagnostic protocol (Max 100 TU)
Diagnostic Time:	GFF	No allowance	0 TU
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	No allowance	0 TU
Claim Comment:	As per TSB #2053028/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Required Parts and Tools

Model	SD Card
All	4M0906961BN



Technical Service Bulletin

Additional Information

The following Technical Service Bulletin will be necessary to complete this procedure:

- TSB 2011732, *00 Software Version Management (SVM), operating instructions.*
- TSB 2047812, *00 SD Creator: How to setup and use the SD Creator for obtaining vehicle software updates via the MirrorServer.*

All part and service references provided in this TSB (2053028) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2018 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.