



# Technical Service Bulletin

---

## 91 Bang & Olufsen: Audio distorted from all input sources

91 18 20 2052251/2 November 29, 2018. Supersedes Technical Service Bulletin Group 91 number 18-07 dated August 24, 2018 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A4	2017 - 2018	All	With Bang & Olufsen
A5	2018	All	With Bang & Olufsen

## Condition

REVISION HISTORY		
Revision	Date	Purpose
2	-	Revised <i>Warranty</i> (Updated Service Number)
1	08/24/2018	Initial publication

### Customer states:

- Audio sounds distorted from door speakers or subwoofer.
- Vehicle is equipped with the Bang and Olufsen sound system.

## Technical Background

Software parameter allows speaker to be overpowered, resulting in distortion.

## Production Solution

New software in the sound system control module, J525 (address word 0047) addressed the condition.

## Service

### SVM Update Instructions

1. Follow all instructions in TSB 2011732: *00 Software Version Management (SVM), operating instructions*.
2. Update the sound system control module, J525 (address word 0047) using the SVM action code as listed in the table below, if necessary:



# Technical Service Bulletin

Model	Old ZDC Number	New ZDC Number	SVM Code Input
A4, A5, A5 Sportback, and A5 Cabriolet	8W0909510A	8W0909510VF	47A006
	8W0909510B		
	8W0909510C	8W0909510F	
	8W0909510D		
	8W0909510E		
	8W0909510F		
	8W2909510A	8W2909510VC	
	8W2909510B		
	8W2909510B	8W2909510C	
	8W5909510A	8W5909510D	
	8W5909510B		
	8W5909510C		

3. Following SVM update, recheck system. If concern is still present, perform diagnostics outside of this TSB.

## Warranty

<b>Claim Type:</b>	<ul style="list-style-type: none"> <li>• 110 up to 48 Months/50,000 Miles.</li> <li>• G10 for CPO Covered Vehicles – Verify Owner.</li> <li>• If vehicle is outside any warranty, this Technical Service Bulletin is informational only.</li> </ul>	
<b>Service Number:</b>	Based On Customer Statement:	
	Front Speaker	9140
	Rear Speaker	9142
	Subwoofer	9136
<b>Damage Code:</b>	0040	



# Technical Service Bulletin

<b>Labor Operations:</b>	Software Update	0151 0000	Time stated on diagnostic protocol (Max 50 TU)
<b>Diagnostic Time:</b>	GFF	No allowance	0 TU
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	No allowance	0 TU
<b>Claim Comment:</b>	As per TSB #2052251/2		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

## Additional Information

The following Technical Service Bulletin will be necessary to complete this procedure:

- TSB 2011732, *00 Software Version Management (SVM), operating instructions*.

All part and service references provided in this TSB (2052251) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

**©2018 Audi of America, Inc.** All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.