

"No Overtaking" Displayed in Combination Meter RSA Menu

Service Category Vehicle Interior

Section Meter/Gauge/Display

Market USA

Lexus Supports
ASE Certification 

Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION
2019	ES350	

Introduction

Some 2019 model year ES350 vehicles may exhibit a "No Overtaking" selection in the Road Sign Assist (RSA) menu on the combination meter multi-information display screen. This selection is not applicable for 2019 model year ES350 vehicles. Follow the Repair Procedure in this bulletin to address this condition.

Warranty Information

OP CODE	DESCRIPTION	TIME	OFF	T1	T2
EL1815	R & R D/C Cut Fuse	0.3	8646C-06040	87	74

APPLICABLE WARRANTY

- This repair is covered under the Lexus Basic Warranty. This warranty is in effect for 48 months or 50,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to occurrence of the specified condition described in this bulletin.

"No Overtaking" Displayed in Combination Meter RSA Menu

Repair Procedure

1. Confirm the condition exists.

Is "No Overtaking" displayed in the RSA menu on the combination meter multi-information display screen?

 - **YES** — Go to step 2.
 - **NO** — This bulletin does NOT apply. Continue diagnosis using the applicable Repair Manual.

Figure 1.



2. Turn the ignition OFF.

3. Remove the cover from the engine room relay block.

Figure 2. Engine Room Relay Block Location




"No Overtaking" Displayed in Combination Meter RSA Menu

Repair Procedure (continued)

4. Remove the D/C cut fuse (25A).
5. Wait 5 minutes.
6. Reinstall the D/C cut fuse (25A).

Figure 3. D/C Cut Fuse Location

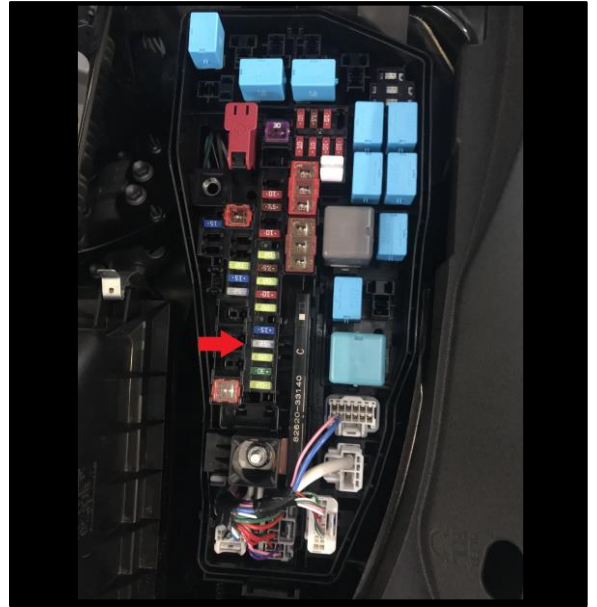

7. Install the cover on the relay block.
8. Turn the ignition ON.
9. Confirm that "No Overtaking" no longer displays in the RSA menu on the combination meter multi-information display screen.

Figure 4.

