

# Technical Service Bulletin

91 Audi Smartphone Interface (ASI): title, album name, and artist shown as "Unknown"

91 18 24 2053257/1 December 13, 2018.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A3, A4, and Q7	2017	All	MIB2 High with Audi Smartphone Interface
A5, Q5	2018	All	MIB2 High with Audi Smartphone Interface

## **Condition**

#### **Customer states:**

• When playing music in the CarPlay menu the title, artist, or album name are shown as "Unknown".

#### Workshop findings:

 This happens mainly in the instrument cluster. The MMI displays all the music information correctly in the menu for Audi Smartphone Interface (ASI).

## **Technical Background**

The software needs to be updated.

### **Production Solution**

Improved MIB software.

### **Service**

#### Required equipment:

- ODIS Tester
- SVM code
- MIB2 High Software update on SD Card (See Required Parts and Tools or Download the software from MirrorServer using the SD Creator Program)

#### Time to complete update:

Approximately 30-60 minutes (includes 20-50 minutes for the software update and 10 minutes for the SVM work)

#### Service work:



# Technical Service Bulletin

Update the MIB2 High infotainment system using either Method 1 or Method 2 according to TSB 2047576: 91 MIB2 High Software Update Instructions (PR Code 7UG) and use SVM code indicated below:

Vehicle	SD Creator Part Number	SVM Code
A4, A5, Q5, and Q7	4M0 906 961 BN	MHI2QUS5087
A3	4M0 906 961 CB	MHI2US5107

Method 1: Automated update using ODIS

Method 2: Manual update due to SVM code or Server issues

## Warranty

Claim Type:	<ul> <li>110 up to 48 Months/50,000 Miles.</li> <li>G10 for CPO Covered Vehicles – Verify Owner.</li> </ul>				
	If vehicle is outside any warranty, this Technical Service Bulletin is informational only.				
Service Number:	9196				
Damage Code:	0039				
Labor Operations:	Software Update	0151 0000	According to TSB #2047576		
Diagnostic Time:	GFF	No allowance	0 TU		
	Road test prior to service procedure	No allowance	0 TU		
	Road test after service procedure	No allowance	0 TU		
Claim Comment:	As per TSB #2053257/1				

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.



# Technical Service Bulletin

## **Required Parts and Tools**

Part Number	Part Description	Quantity
4M0906961BN	A4, A5, Q5, and Q7  MMI software update (SD Card) – Or download via SD creator Software	01 (Shop tool)
4M0906961CB	A3 MMI software update (SD Card) – Or download via SD creator Software	01 (Shop tool)

### **Additional Information**

The following Technical Service Bulletin will be necessary to complete this procedure:

- TSB 2047576, 91 MIB2 High Navigation Software Update Instructions (PR Code 7UG).
- TSB 2047812, 00 SD Creator: How to setup and use the SD Creator for obtaining vehicle software updates via the MirrorServer.

All part and service references provided in this TSB (2053226) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2018 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.