

Reversing camera closes

Topic number	LI54.65-P-063067
Version	2
Function group	54.65 Parking assist
Date	12-10-2018
Validity	Model 253 with SA code 218 (Reversing camera)
Reason for change	Change to part numbers
Reason for block	

Complaint:

The reversing camera closes a short time after opening.

Cause:

Pins 1 and 2 on the rear camera cover motor (M35/2) might be loose (the line has detached from the female contact). This is due to a crimping fault; the lines are 0.13mm² (small cross section).

Remedy:

Repair using pigtail (contact socket with loose cable ends).

Please do not change any other parts!

Symptoms

Communication/information / Assistance and warning systems / Parking assist / Reversing camera / Malfunction

Control unit/fault code

Control unit	Fault code	Fault text
B84/3 - Backup camera (RFK) (RVC222)	B129B00	Control unit "Camera cover" has a malfunction. _

Parts

Part number	ES1	ES2	Designation	Quantity	Note	EPC
A 000 540 18 03			MCP 1.2	2	Pigtail	X
A 000 982 95 10			Cable connector	2		X
W00058930370 0			Wire stripper	1	For stripping thin wire conductors with a cross section of 0.13mm ² . Adjustable stripping length.	

Attachments

File	Description
------	-------------

XENTRY TIPS

image of connector.jpg	Picture of connector
------------------------	----------------------

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
			590A7 74	K/Z*, trunk lid/liftgate camera cover drive unit

WIS-References			
Document number	Title	Note	Allocation
AR00.19-P-0100-12A	Repair wiring harness with wire cross section 0.13mm ² using axial solder connectors		Remedy
AR00.19-P-0100-08A	Protect repair point after line repair		Remedy

Attachments

XENTRY TIPS

image of connector.jpg:



XENTRY TIPS
