

## QUARANTINE NOTICE

<b>Reference number:</b>	<b>QN-01-1144</b>	<b>Issued: 23 November, 2018</b>
<b>Subject:</b>	<b>Incorrect Alignment of Door Latch Striker</b>	
<b>Model(s):</b>	<b>Vantage 19MY</b>	
<b>VIN range:</b>	<b>Refer to the separately published list of affected Vehicle Identification Numbers (VINs)</b>	
<b>Applicable to:</b>	<b>All Dealers</b>	
<b>Distribute to:</b>	<b>After Sales Manager</b> <b>Executive Manager</b> <b>Service Manager</b> <b>Sales Manager</b>	<b>Warranty Staff</b> <b>Technician(s)</b> <b>Parts Staff</b>

### Reason for this Quarantine Notice

Aston Martin has identified that the door striker can be incorrectly aligned to the door latch on some Vantage 19MY vehicles. This prevents correct closure of the vehicle doors. Do the Workshop Procedure that follows to correct this problem.

### Workshop Procedure

1. Visually inspect the door striker on both sides of the vehicle to make sure that it is aligned correctly.
2. If the door striker is aligned correctly and damage is not visible on the flat edge of the door striker, the check is complete.
3. If the door striker is not correctly aligned, the door striker must be removed (refer to Workshop Manual Procedure 01.14.CA for the right side door striker or 01.14.CB for the left side door striker).

**Note: If contact marks are visible on the door striker (refer to Figure 1), the door striker is not correctly aligned.**



**Figure 1**

4. Visually inspect the rivet head to make sure that it is flush on the door opening panel (refer to Figure 2).

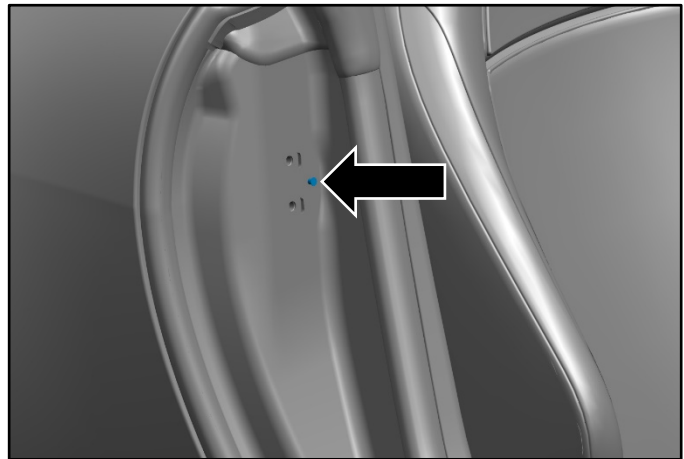


Figure 2

5. If the rivet head is not aligned correctly, use a punch (6mm diameter flat nose) with a mallet to align the rivet head correctly.
6. Install the door striker (refer to Workshop Manual Procedure 01.14.CA for the right side door striker or 01.14.CB for the left side door striker).
7. Do a check to make sure that the door closes correctly. Adjust the door if necessary.

### Warranty Data

#### Procedure and Labour Time

Description	Labour Time (Inspect)	Labour Time (Inspect and Repair)	Tier
Inspect and if necessary adjust Right Side striker	0.05 hours	0.05 hours	A
Inspect and if necessary adjust Left Side striker	0.05 hours	0.05 hours	B
Inspect and if necessary adjust Left Side and Right Side striker	0.05 hours	0.1 hours	C

If you have any questions related to this Quarantine Notice, please contact: Aston Martin Technical Services on: +44 (0) 1926 644720, email: askamtech@astonmartin.com, or contact your After Sales Manager.

The English version of this Quarantine Notice is written in Simplified Technical English to ASD-STE100™.