



Bulletin No.: PIP5612
Published date: N/A

Preliminary Information

PIP5612 Whistle Noise From The Crank Case

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Silverado 1500 (New Model)	2019	All	All	5.3L 6.2L L82 L84 L87	All
GMC	Sierra 1500 (New Model)	2019	All	All	5.3L 6.2L L82 L84 L87	All

Involved Region or Country	North America
Condition	A vehicle may have a humming , whining or whistle noise from engine bellhousing area.
Cause	This could be caused by a restriction in the PCV system.

Correction:

Remove the oil fill cap and see if the concern is gone.

If the concern is gone inspect the foul and fresh air sides of the PCV system for any restriction.

If nothing found replace the left valve cover.

Engineering is looking at the root cause at this time

Warranty Information

Please use published labor times for the repair that was performed

Version History

Version	1
Modified	12/04/2018 - Created on



GENERAL MOTORS