



Bulletin No.: PIP5612A
Published date: 12/6/2018

Preliminary Information

PIP5612A Whistle Noise From The Crank Case

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Silverado 1500 (New Model)	2019	All	All	5.3L 6.2L L82 L84 L87	All
GMC	Sierra 1500 (New Model)	2019	All	All	5.3L 6.2L L82 L84 L87	All


Involved Region or Country	North America
Condition	A vehicle may have a humming , whining or whistle noise from engine bellhousing area.
Cause	This could be caused by a restriction or excessive vacuum in the PCV system.

Correction:

Remove the oil fill cap and see if the concern is gone.

If the concern is gone inspect the foul and fresh air sides of the PCV system for any restriction.

Looking at the PCV port in the left valve cover As seen below.

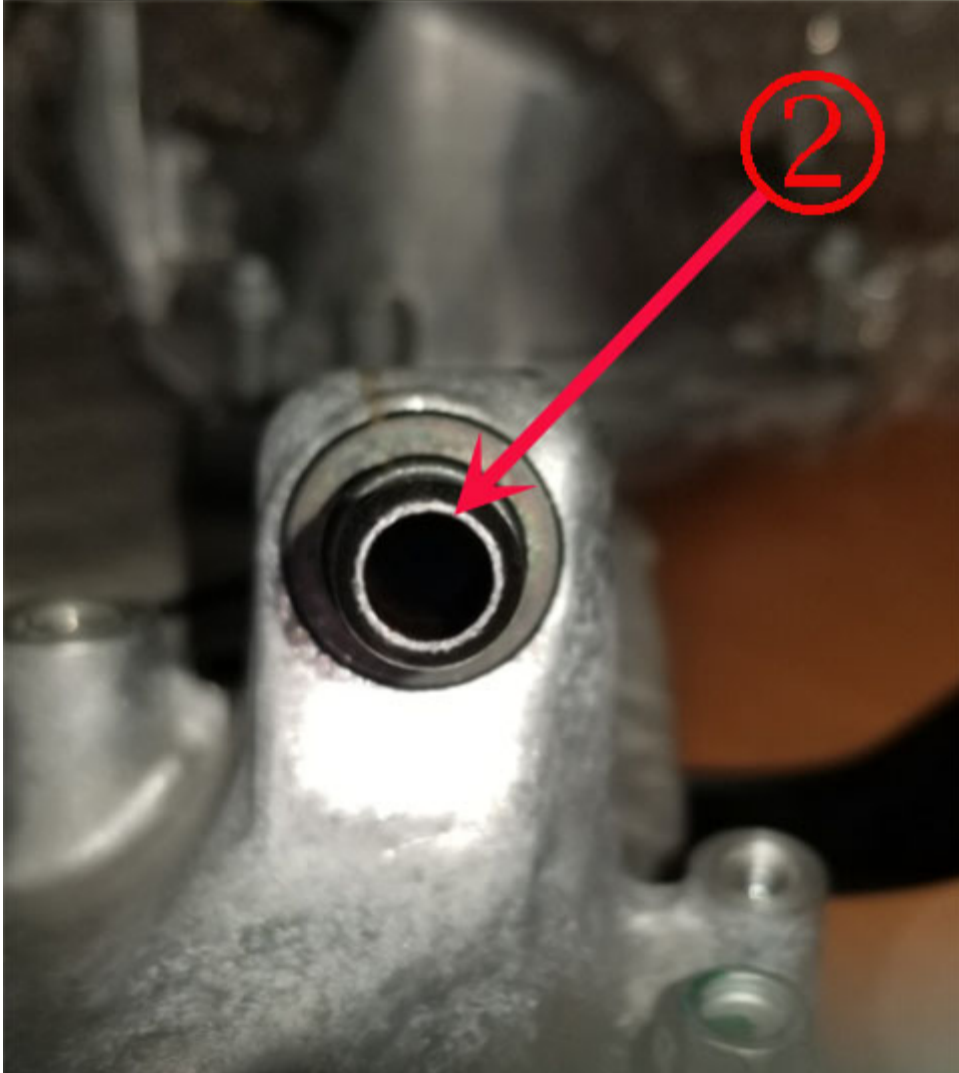

1. Shows a good PCV orifice

2. Shows the the PCV orifice missing

If this is found replace the left valve cover.

Engineering is looking at the root cause at this time

Warranty Information

Please use published labor times for the repair that was performed

Version History

Version	2
Modified	12/04/2018 - Created on 12/06/2018 - Updated Correction Information



© 2019 General Motors. All Rights Reserved.