

Service Bulletin

File in Section:

Bulletin No.: 18-NA-297

Date: December, 2018

TECHNICAL

Subject: Message Displaying Shift to Park when in Park

This Bulletin replaces PIT5616C. Please discard PIT5616C.

Brand:	Model:	Model Year:		VIN:		Engine	Transmission:
		from	to	from	to	Engine:	Transmission.
Charmalat	Malibu	2016	2018				
Chevrolet	Traverse	2018	2018			All	All
GMC	Acadia	2017	2018				

Involved Region or Country	North America and N.A. Export Regions	
Condition	Some customers may comment on an intermittent Shift to Park message when in Park and turning off the vehicle.	
Cause	The cause of the condition may be the park switch in the transmission control (shifter) assembly not pulling BCM signal low to electronically show Park condition.	
Correction	Replace the transmission control (shifter) assembly.	

Service Procedure

Refer to Transmission Control Replacement in SI.

Parts Information

Causal Part	Description	Part Number	Qty
Х	Control A/Tropo	13528228 (Acadia)	1
Х	Control, A/Trans	13520828 (Malibu)	1
Х	Control ASM-A/ Trans (W/O Base)	13528229 (Traverse)	1

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
8460670	Transmission Control Replacement	Use Published Labor Operation Time

Version	2	
Modified	Released October 3, 2018	
	December 13, 2018 – Added the Traverse model and Parts Information.	

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.

